



Service Bulletin

82-S0515

September 29, 2009

! NOTICE

Forced and/or reversed power and motor connections made during the replacement of room slide controls will result in a damaged control unit.

Room Slide Control Replacement (Installation Instructions)

Forced and/or reversed power and motor connections made during the replacement of the following room slide controls will result in a damaged control unit.

<u>Control Unit</u>	<u>Power Gear Part #</u>	<u>Winnebago Part #</u>
RPE FLS control	1510000154	171064-01-000
FLS Single control	1510000152	171064-02-000
RPE control	1510000151	171058-02-000
Single FLS control	1510000153	171058-01-000
FLS control	1510000180	171058-03-000

The battery (power) and motor harness receiving hole connection points (located between the 1st and 2nd blade connectors) are identified on the decal located on the control to ensure proper installation.

Battery (power) harness connection

(MY'09 and prior uses a 4-pin connector with round shaped plug)


(MY'10 uses a 4-pin Molex connector)

Motor Harness Connection

(MY'09 and prior uses a 4-pin connector with oval shaped plug)

(MY'10 uses a 5-pin Molex connector)

Effective October 1, 2009, Power Gear will no longer warranty parts and labor on replacement control units that are improperly installed.

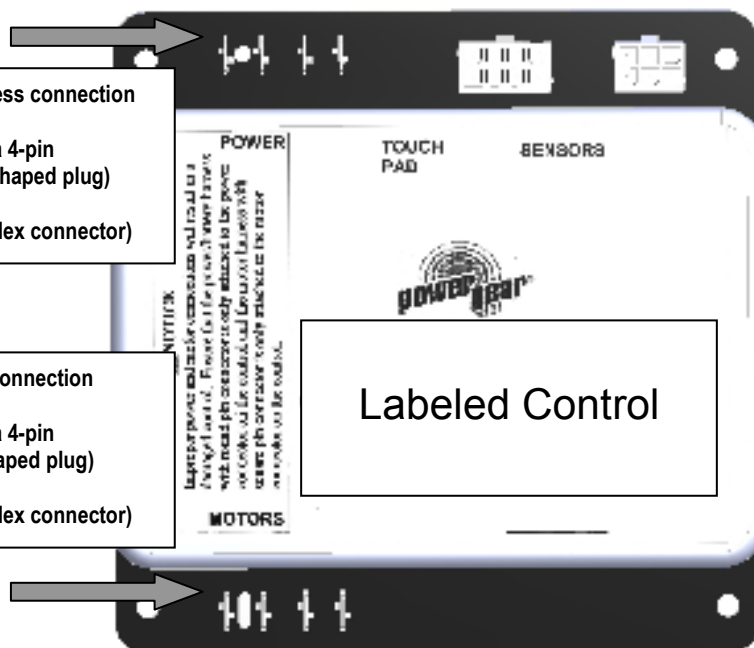

For ease of installation, and to ensure proper connection, replace one harness at a time.



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.