

SLIDE-OUTS


Purpose

This document is for identifying the differences between the standard (Fig. 1) and inverted (Fig. 2) gear racks of an In-wall Slide-out system.


Starting March 2019, all In-wall systems were manufactured with the inverted gear rack system. There are specific repair kits available for the Standard and Inverted gear rack systems.

Fig. 1

Standard Gear Rack

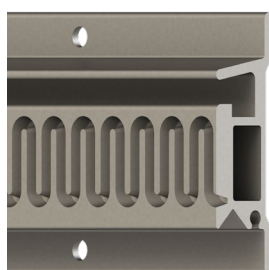

Upper Rack

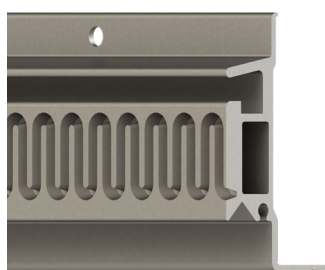


Lower Rack




Fig. 2

Inverted Gear Rack

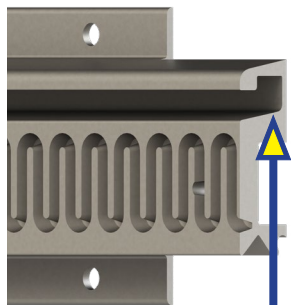


Upper Rack

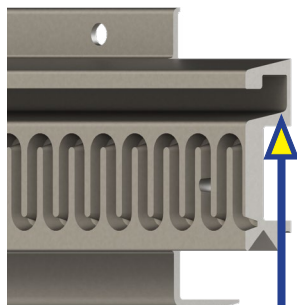

Lower Rack

Inverted design allows for better water deflection.

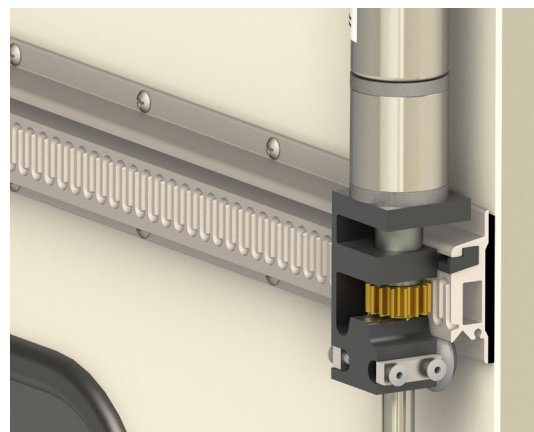

NOTE: The assembly images on the right in Figures 1 and 2 are cut-out for clarity. The installed system will not have the same view.

SLIDE-OUTS


Replacement

If an entire standard system needs to be changed out, it will be replaced by an inverted system, but repair kits for the standard system will still be available.

Repair Kits Part Numbers

Standard (w/ 1.56" Notch)

Fig. 3 - 1.56" Notch

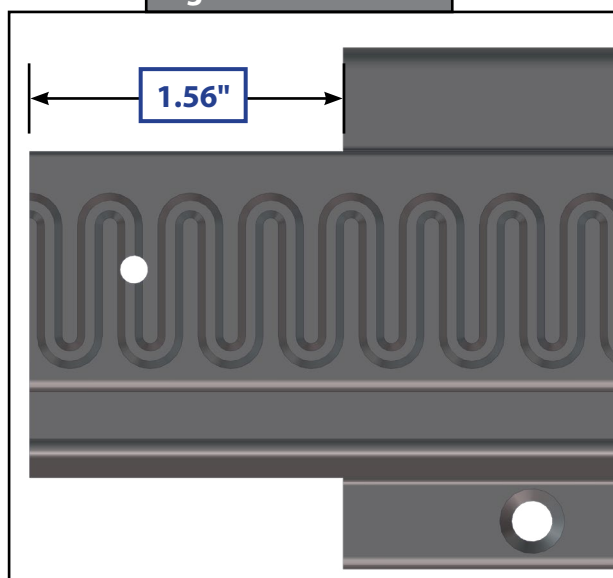

Repair Kit Part Numbers		
Clear Part #	Black Part #	Description
366154	366209	Standard Fixed Repair Kit
366156	366211	Standard Float Repair Kit
366158	366212	Inverted Fixed Repair Kit
366159	366213	Inverted Float Repair Kit
366160	366214	Triple Fixed Repair Kit
366161	366215	Triple Float Repair Kit

Bearing Block Repair Kit

If the bearing blocks need to be replaced, a repair kit that includes one upper and one lower bearing block, four plastic rivets, and two aluminum rivets is available. Part numbers are on the table below.

NOTE: Triple Bearing Block kit will include one upper and two lower bearing blocks, six plastic rivets, and three aluminum rivets.

Bearing Block Repair Kit Numbers	
Kit #	Description
379060	Standard Bearing Block Repair Kit
379076	Inverted Bearing Block Repair Kit
379077	Narrow Bearing Block w/ Composite Gibs Repair Kit
379720	Triple Bearing Block Repair Kit

SLIDE-OUTS

Custom

If the system being repaired has a different notch than the 1.56" described in Figure 3, use the images below to identify the notch, then contact LCI at (574) 537-8900 for ordering assistance.

NOTE: If the gear rack being replaced has notches on both ends, the rack will need to be custom ordered. Contact LCI at (574) 537-8900 for ordering assistance.

Custom Kit Numbers	
Kit #	Description
366121	Standard (without gear racks)
366120	Inverted (without gear racks)
366106	Triple (without gear racks)

Fig. 4 - 1.0" Gutter Notch

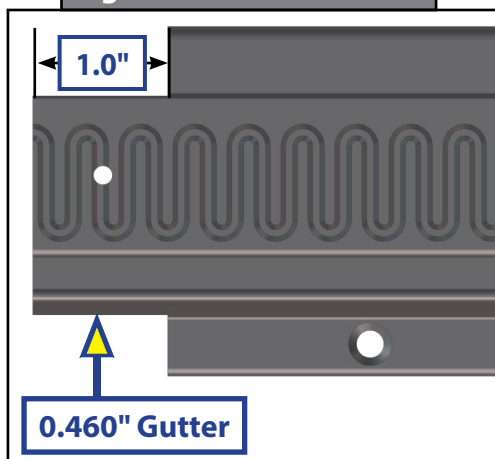


Fig. 5 - 1.0" Notch

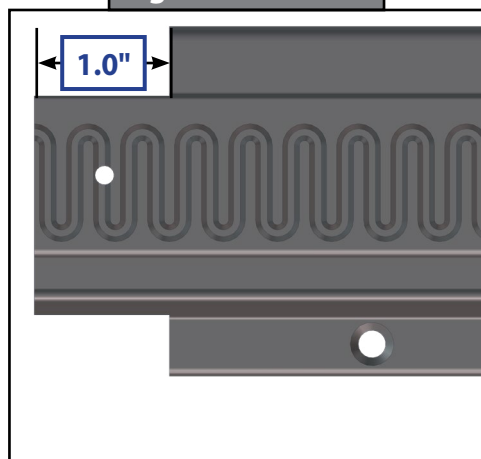


Fig. 6 - 1.75" Notch

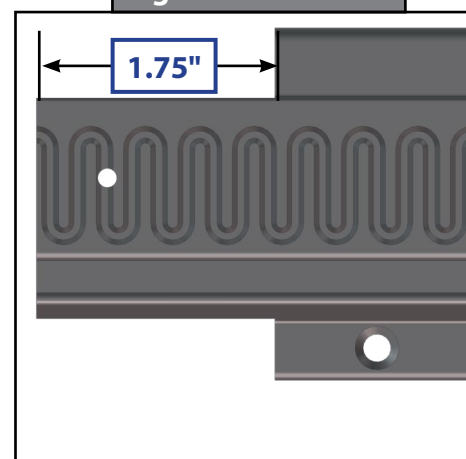


Fig. 7 - 2.0625" Notch



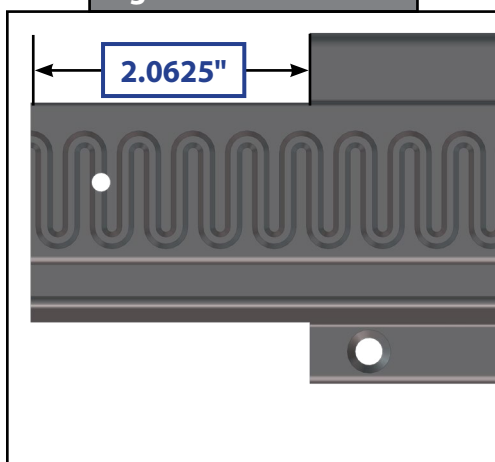


Fig. 8 - Tiffin Notch

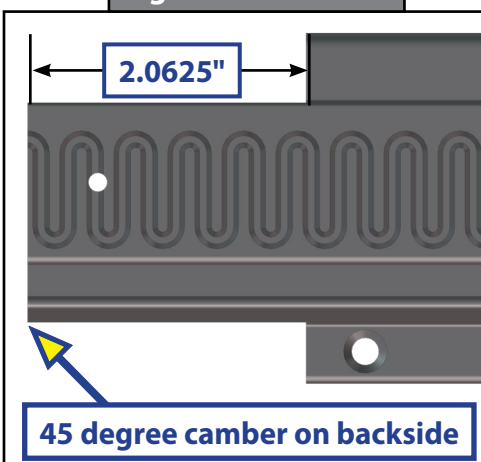

Pinnacle Notch

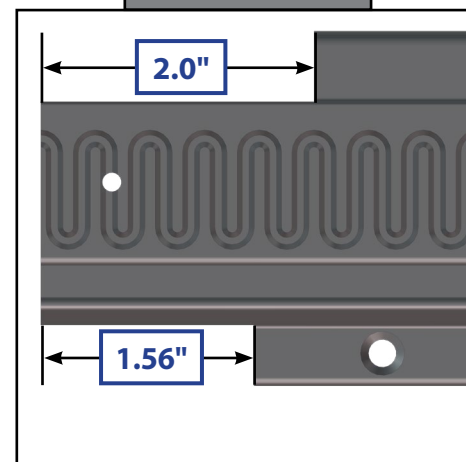

As a supplier of components to the RV industry, safety, education and customer satisfaction are our primary concerns. Should you have any questions, please do not hesitate to contact us at (574) 537-8900 or by email at customerservice@lci1.com. Self-help tips, technical documents, product videos and a training class schedule are available at lci1.com or by downloading the MyLCI app.



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.