

WINDOWS

Purpose

This document outlines the procedure for replacing/installing the 8800 series window full exit latch.

NOTE: Images used in this document are for reference only when assembling, installing and/or operating this product. Actual appearance of provided and/or purchased parts and assemblies may differ.

Safety

Read and fully understand all instructions before installing or operating this product. Adhere to all safety labels.

CAUTION

The “CAUTION” symbol above is a sign that a safety risk is involved and may cause personal injury and/or product or property damage if not safely adhered to and within the parameters set forth in this manual.

CAUTION

Moving parts can pinch, crush or cut. Keep clear and use caution.

Procedure

1. Move the latch handle up to the open position (Fig. 1A).
2. Remove the two Phillips screws (Fig. 1B) in latch base (Fig. 1C) and set aside for reinstallation.
3. Remove the old latch and insert the new replacement latch, in the open position (Fig. 2A), into the outer frame notch (Fig. 2B).

Fig. 1




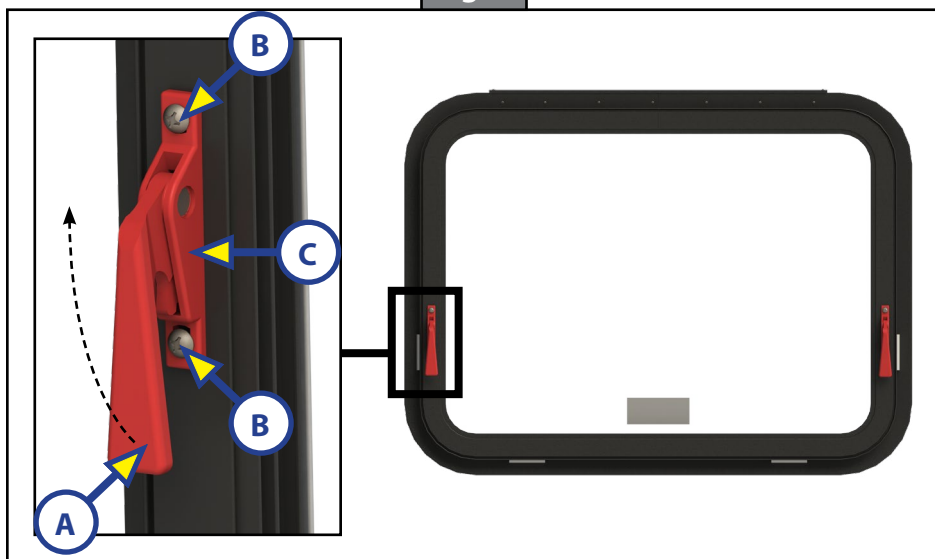


Fig. 2

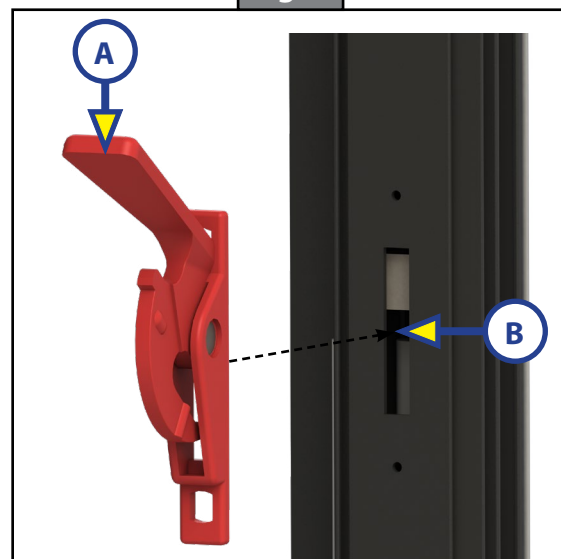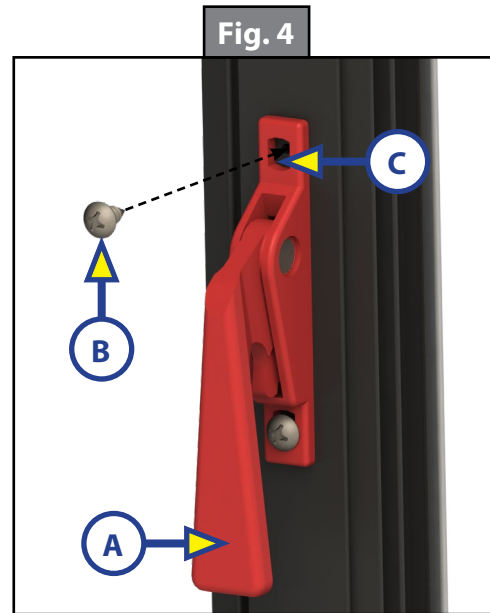


WINDOWS

4. With the latch handle in the open position (Fig. 3A), fasten the previously removed bottom screw (Fig. 3B) into the latch base and frame (Fig. 3C).
5. Close the latch handle (Fig. 4A) and fasten the previously removed top screw (Fig. 4B) into the latch base and frame (Fig. 4C).

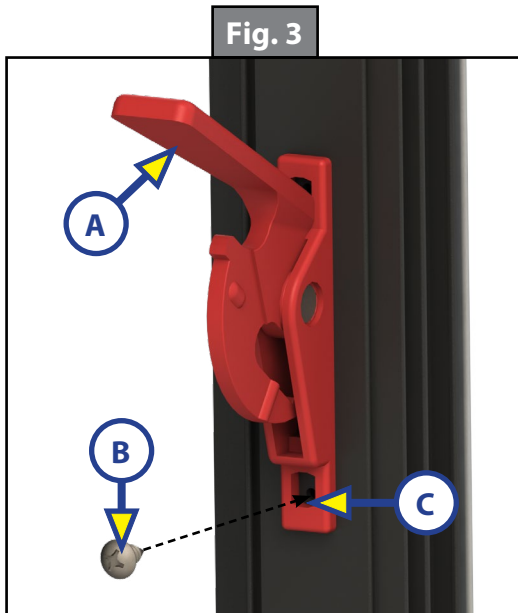

6. A "click" sound can be heard when the latch is completely closed and properly engaged.
7. If the latch handle will not engage properly, the latch catch can be moved to make a proper connection.
 - A. Open the window and remove the two catch screws (Fig. 5A) located on the side of the inner panel.
 - B. Move the catch (Fig. 5B) so the center is in line with the center of the rivet (Fig. 5C) on the latch handle.
 - C. Reinsert the two catch screws and close the window, making sure a "click" sound can be heard when the latch is completely closed and properly engaged.
 - D. If needed, repeat steps 1-7 for the opposite side latch in the window frame.

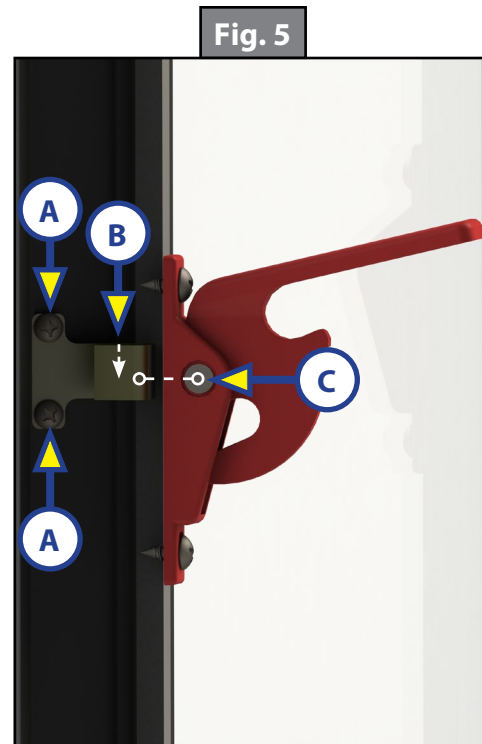

As a supplier of components to the RV industry, safety, education and customer satisfaction are our primary concerns. Should you have any questions, please do not hesitate to contact us at (574) 537-8900 or by email at customerservice@lci1.com. Self-help tips, technical documents, product videos and a training class schedule are available at lci1.com or by downloading the MyLCI app.



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.