


NOTE: Part numbers are shown for identification purposes only. Not all parts are available for individual sale. All parts with a link to the Lippert Store can be purchased.

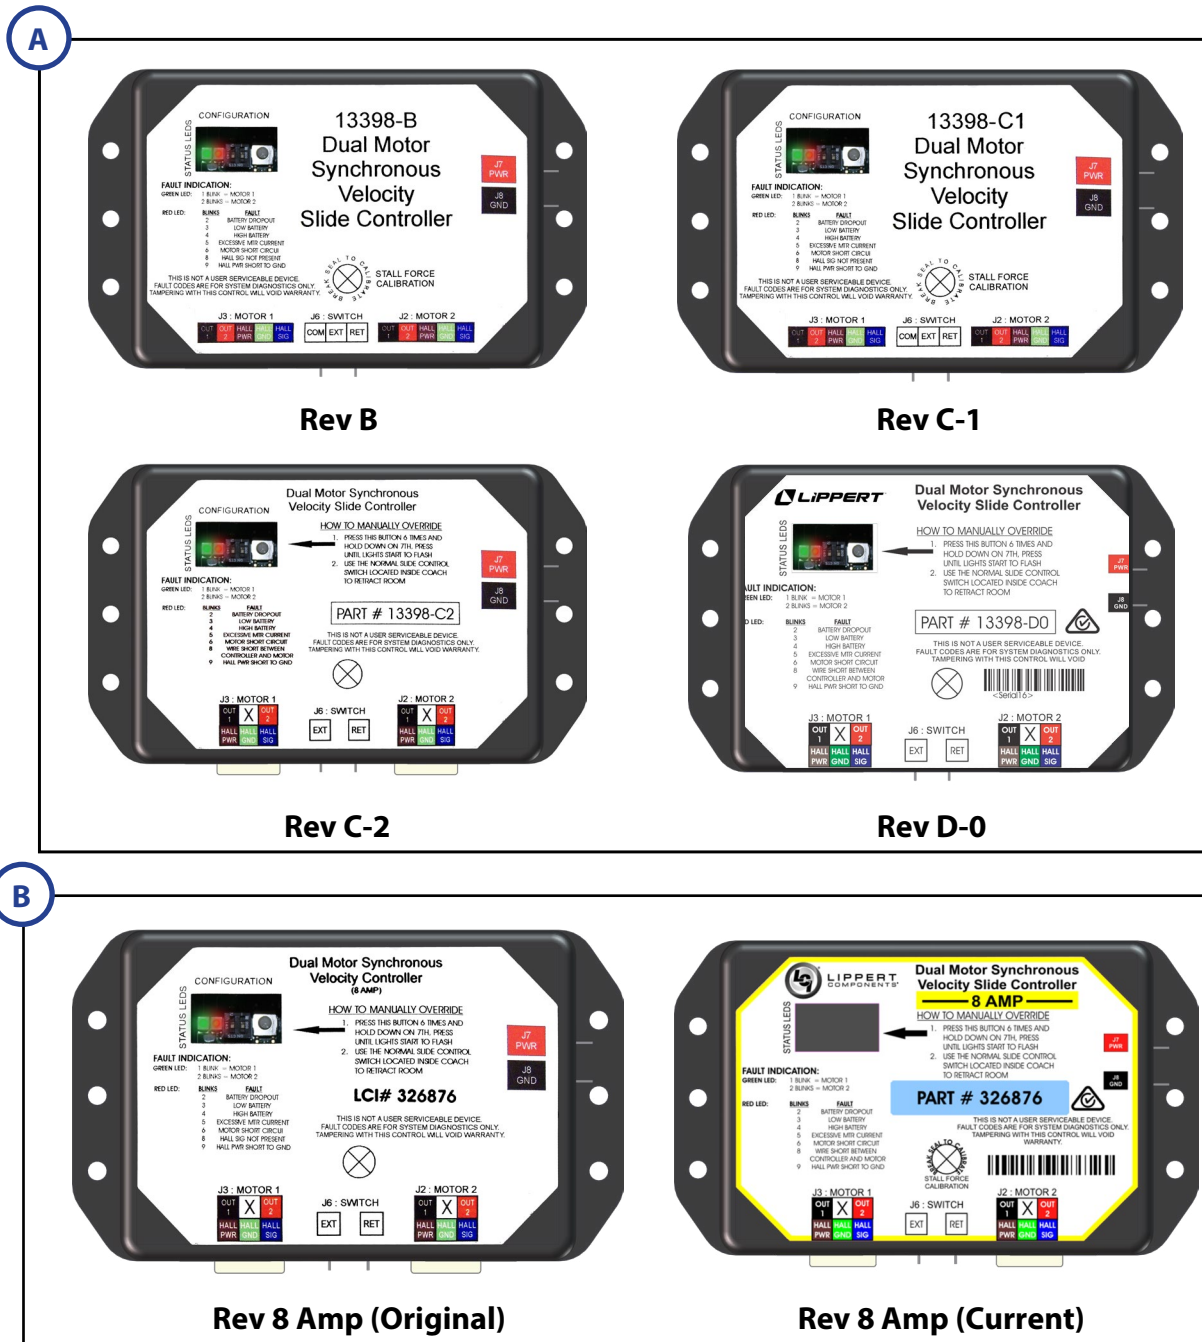


Callout	Part #	Description
A	211852	Dual Motor Synchronous Velocity Slide Controller
B	326876	8 Amp Dual Motor Synchronous Velocity Slide Controller (Original)
		8 Amp Dual Motor Synchronous Velocity Slide Controller (Current)
NOTE: This controller (B) will not replace other controller versions.		
NOTE: Controller 326876 can only be used with systems that have PN 287298 500:1 High Torque motor.		

IN-WALL® SLIDE-OUT COMPONENTS

SLIDE-OUTS




Callout	Part #	Description
C	229466	Motor, 300:1 (OBSOLETE - contact Lippert Customer Care for system replacement assistance)
D	236575	Motor, 300:1 (Original, No Longer Available. Substitute with current version.)
		Motor, 300:1 (Current version. Available.)
E	287298	Motor, High Torque 500:1

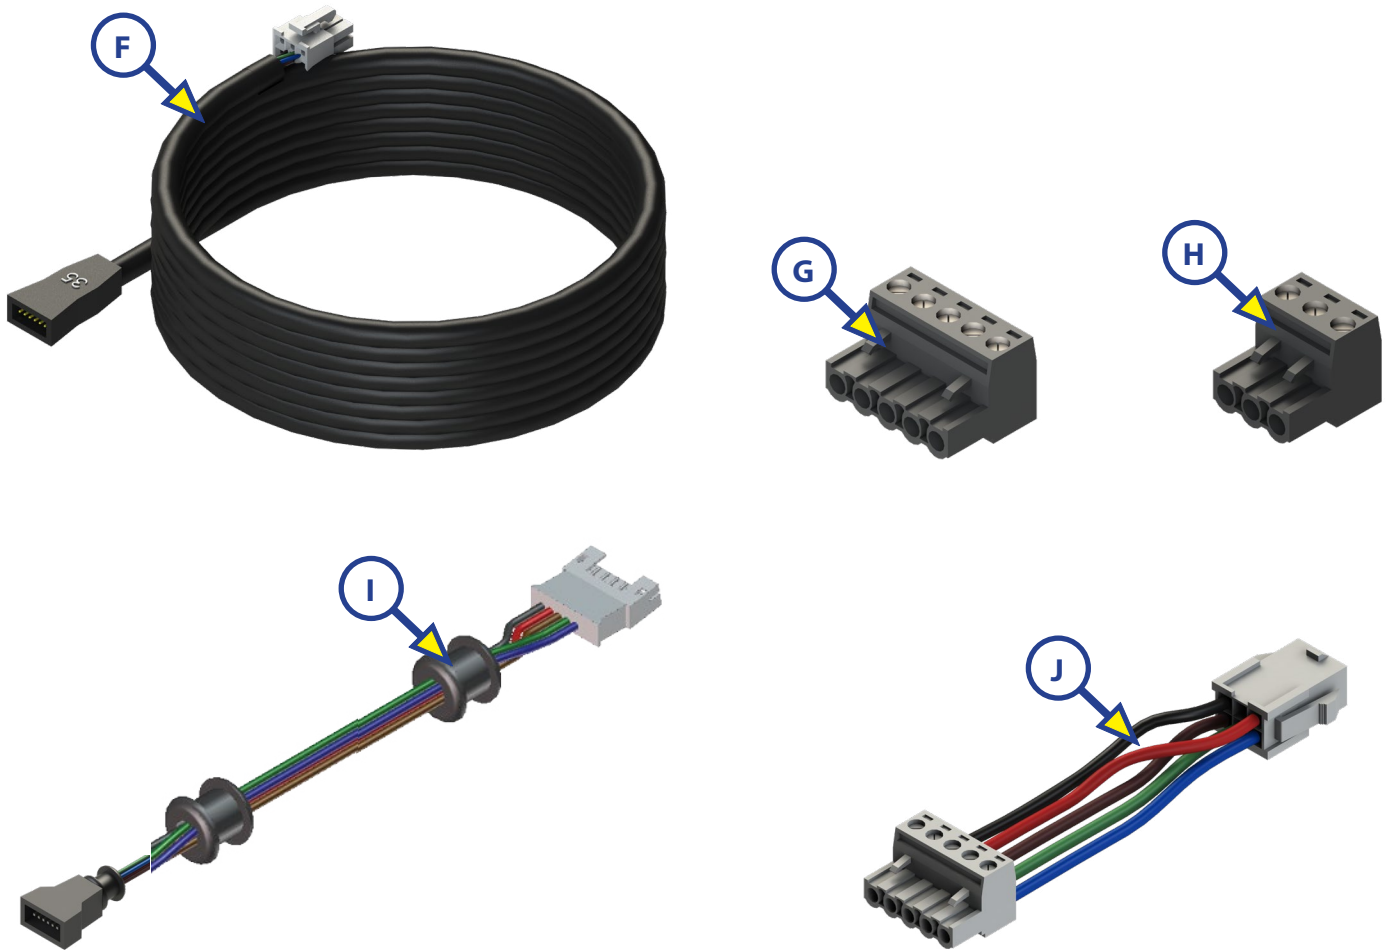

Callout	Part #	Description
F	238744	5 ft. Controller to Motor Harness
	238990	10 ft. Controller to Motor Harness
	247768	15 ft. Controller to Motor Harness
	229755	20 ft. Controller to Motor Harness
	238991	25 ft. Controller to Motor Harness
	229756	30 ft. Controller to Motor Harness
	238992	35 ft. Controller to Motor Harness
G	229758	Harness Connector 5 Wires (OBSOLETE)
H	229759	Harness Connector 3 Wires (OBSOLETE)
I	241834	5 ft. Interconnect Harness
	241835	6 ft. Interconnect Harness
	241836	8 ft. Interconnect Harness
J	258760	6" Pigtail Harness (OBSOLETE)

IN-WALL® SLIDE-OUT COMPONENTS











SLIDE-OUTS

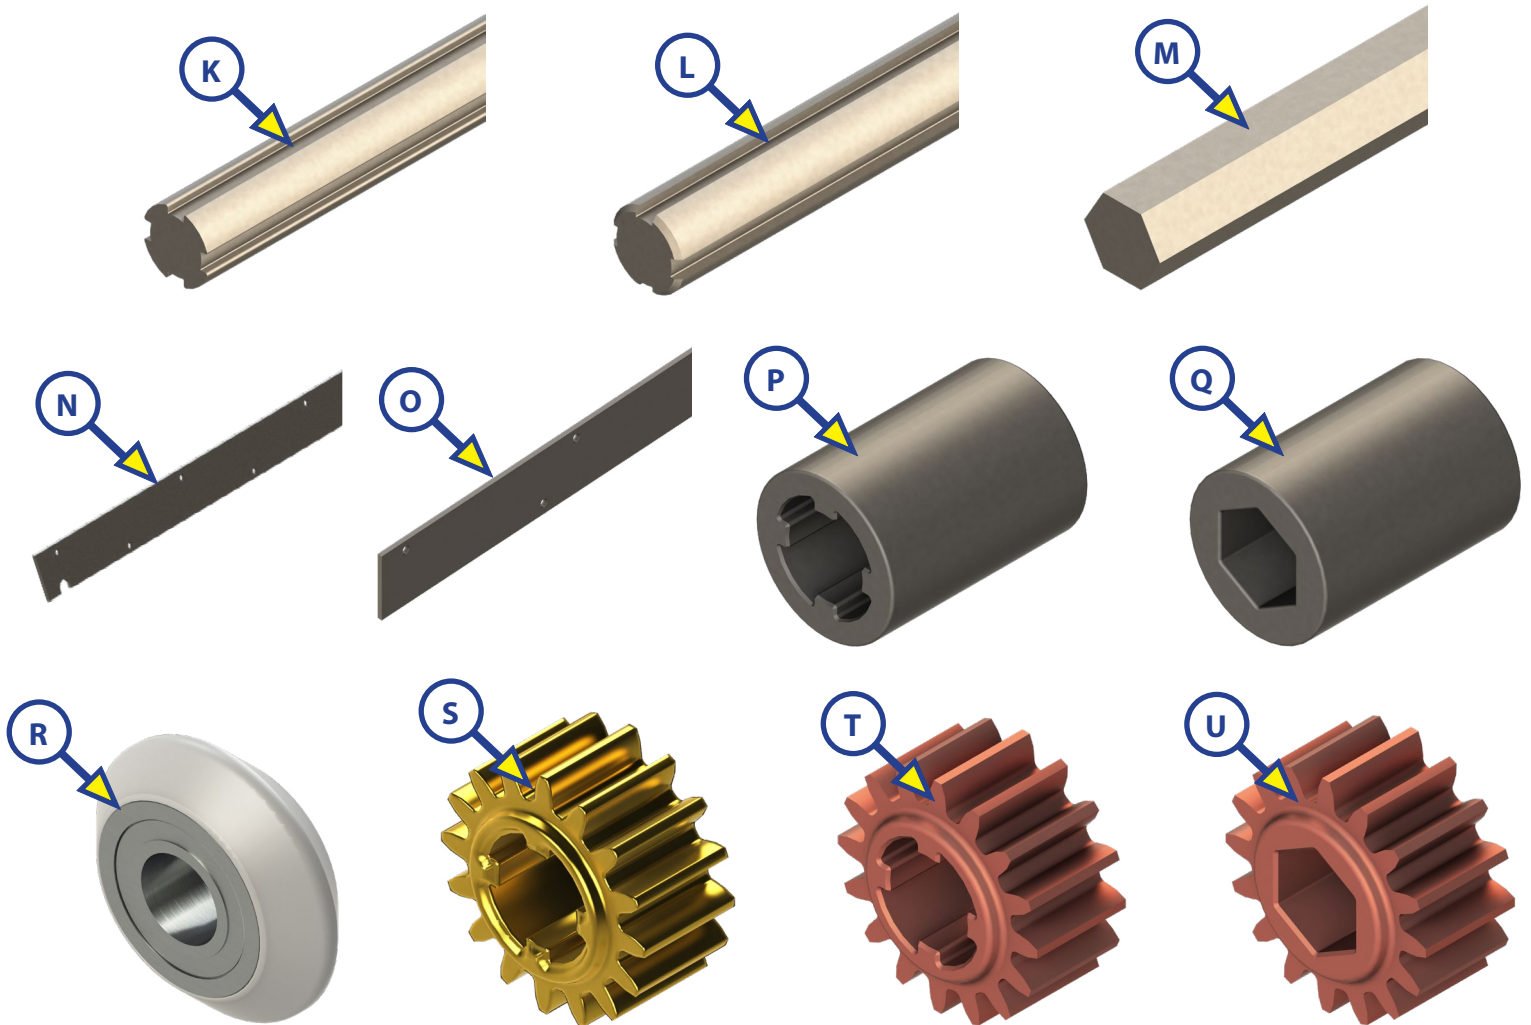

Callout	Part #	Description
K	238462	Aluminum Torque Shaft
L	259065	Steel Torque Shaft
M	295873	Hex Torque Shaft
N	389787	In-Wall Column Clamp (1.44" x Varies)
O	701324	In-Wall Column Clamp (1.5" x 16")
P	238461	Coupler - Old Style (for 229466 Motor)
		Coupler - New Style (for 236575 Motor)
Q	285083	Hex Coupler
R	292801	V-Roller Assembly
S	238893	Spur Gear
T	292435	Copper Infused Spur Gear
U	285085	Hex Spur Gear



IN-WALL® SLIDE-OUT COMPONENTS

SLIDE-OUTS

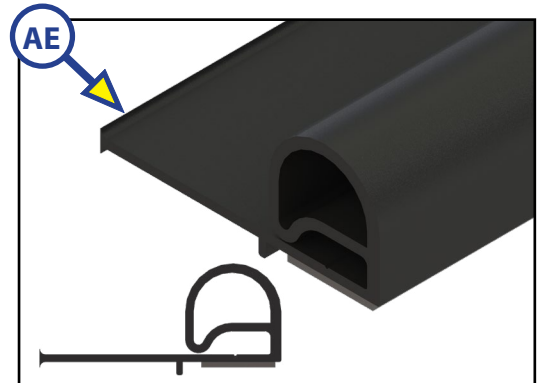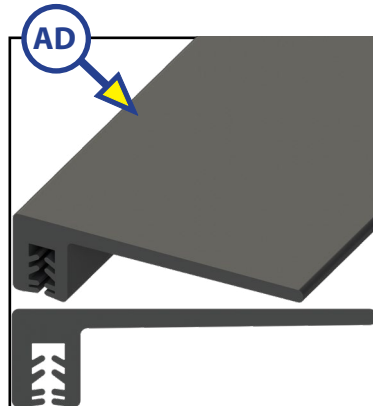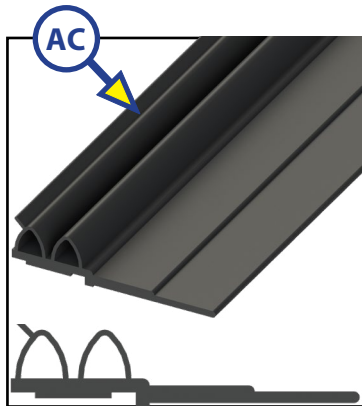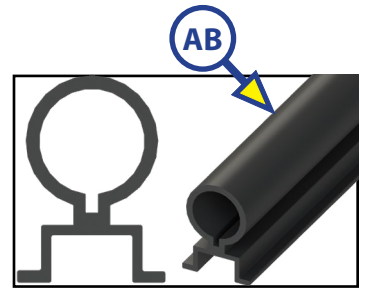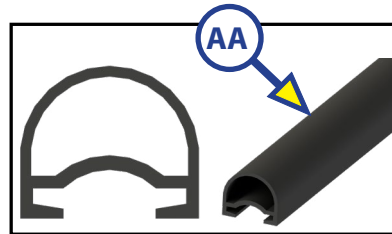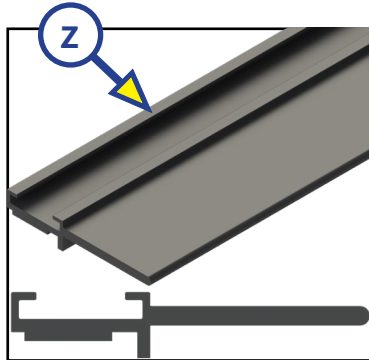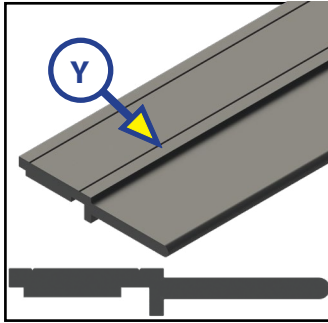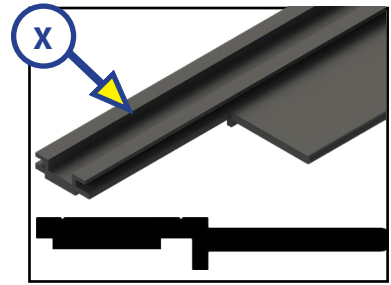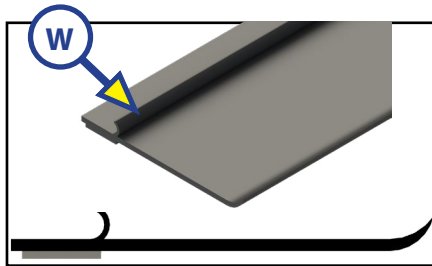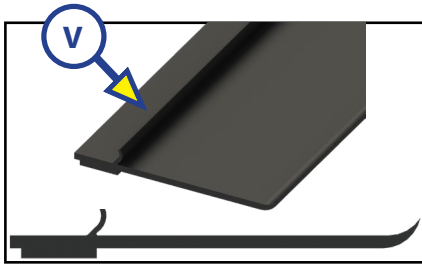



Callout	Part #	Description	Measurements
V	156603	Seal (OBSOLETE)	1" x 2 21/32" x 5/64"
W	132733	Sweep Seal (OBSOLETE)	2 43/64" x 1/16"
X	239667	EK Design Flap	1 1/4"
Y	240410	Flat Side Wiper	1 1/4"
Z	240448	KE Black Single Wiper with Leg	1 1/4"
AA	260406	KE Black Slide on D-Seal	-
AB	366736	Bulb Seal	-
AC	253344	Winnebago Double Bulb Seal	-
AD	300614	Slide-Out Seal (OBSOLETE)	144"
AE	862251	Optional Seal	-

Standard (With 1.56" Notch)

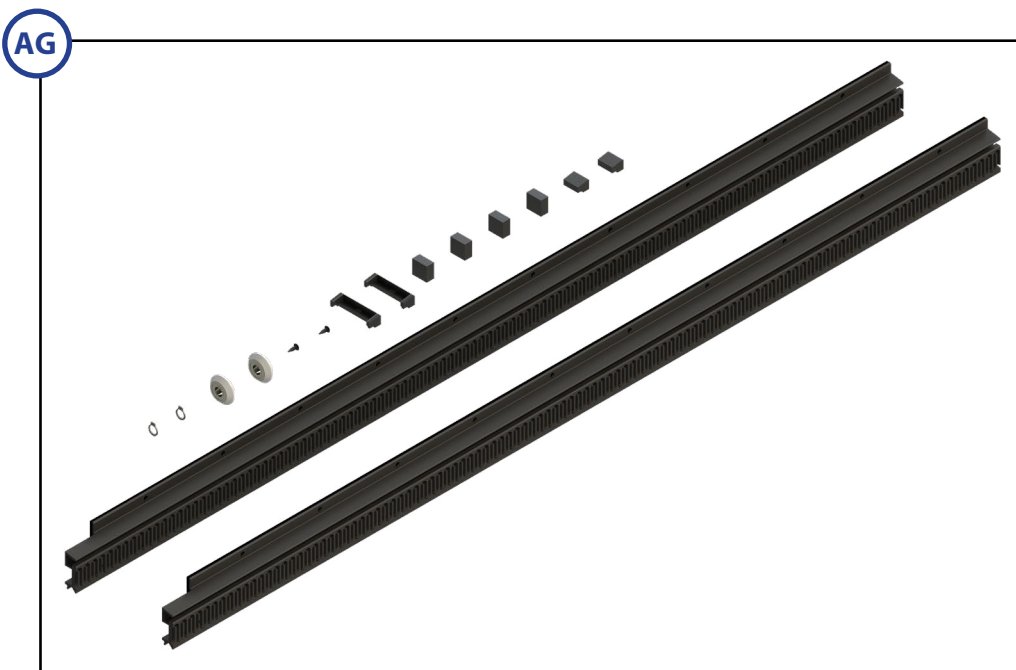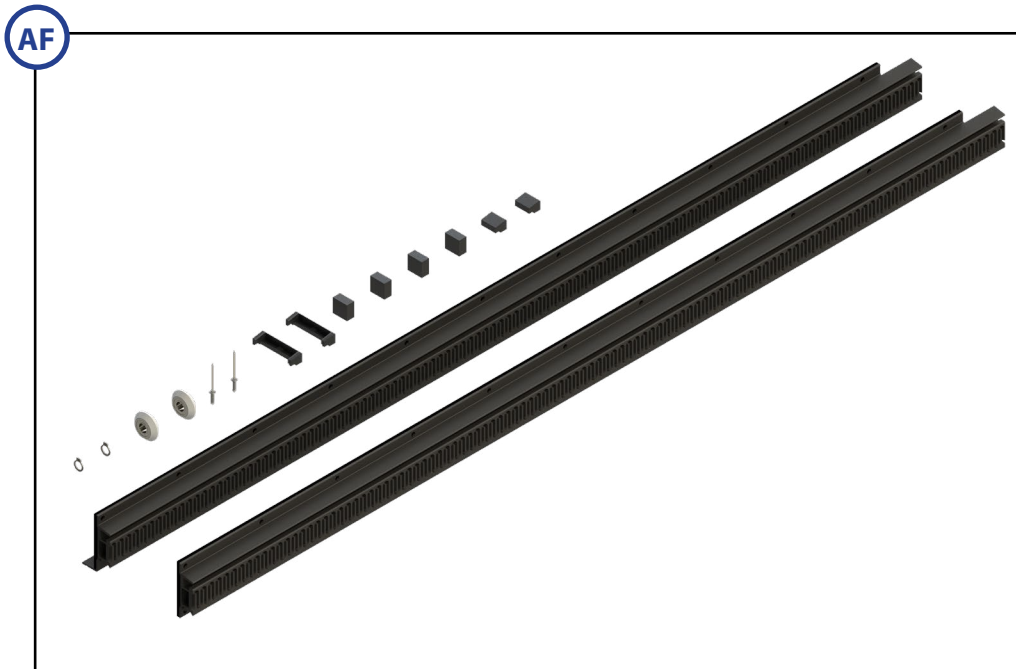



Callout	Part #	Description
AF	366154	Clear Standard Fixed Repair Kit
	366209	Black Standard Fixed Repair Kit
AG	366156	Clear Standard Float Repair Kit
	366211	Black Standard Float Repair Kit

Inverted (With 1.56" Notch)

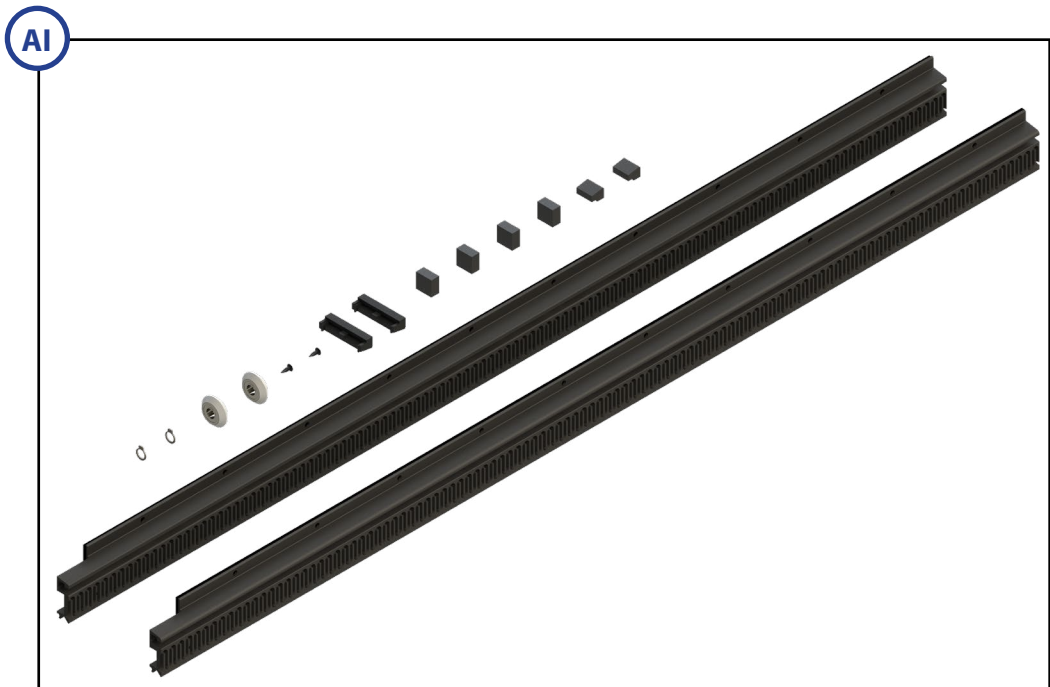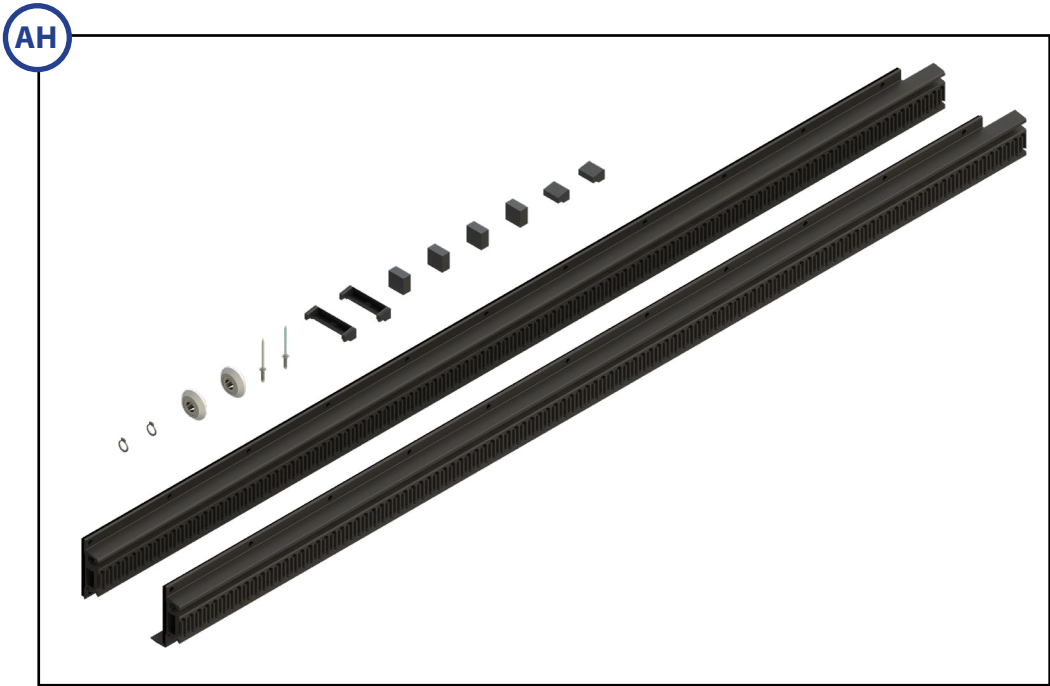

Callout	Part #	Description
AH	366158	Clear Inverted Fixed Repair Kit
	366212	Black Inverted Fixed Repair Kit
AI	366159	Clear Inverted Float Repair Kit
	366213	Black Inverted Float Repair Kit

Triple (With 1.56" Notch)

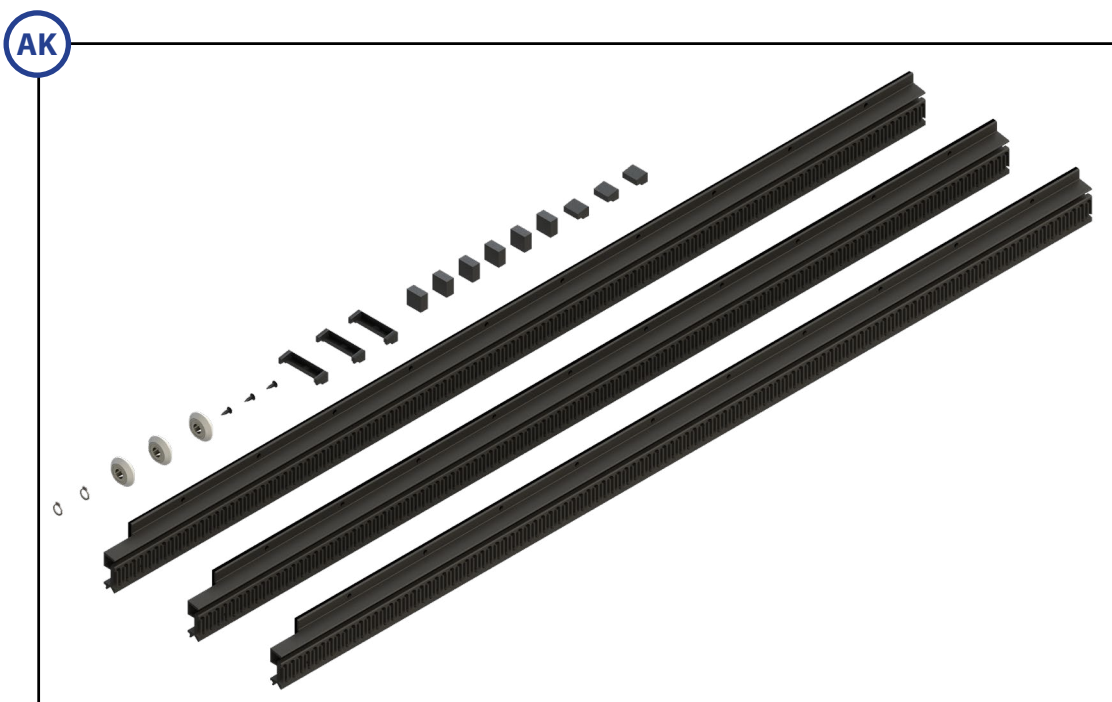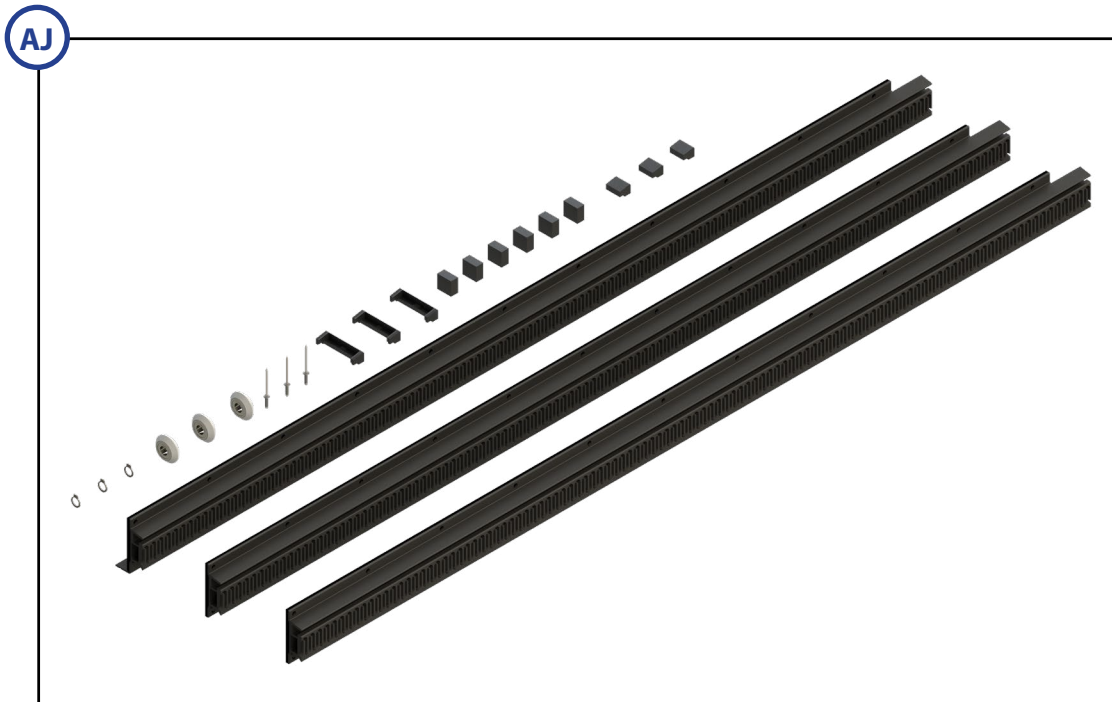


Callout	Part #	Description
AJ	366160	Clear Triple Fixed Repair Kit
	366214	Black Triple Fixed Repair Kit
AK	366161	Clear Triple Float Repair Kit
	366215	Black Triple Float Repair Kit

Bearing Block Repair Kit (With 1.56" Notch Gear Rack)

If the bearing blocks need to be replaced, a repair kit that includes one upper and one lower bearing block, four plastic rivets, and 2 aluminum rivets is available. Part numbers are on the table below.

NOTE: Triple Bearing Block kit will include one upper and two lower bearing blocks, 6 plastic rivets, and 3 aluminum rivets.





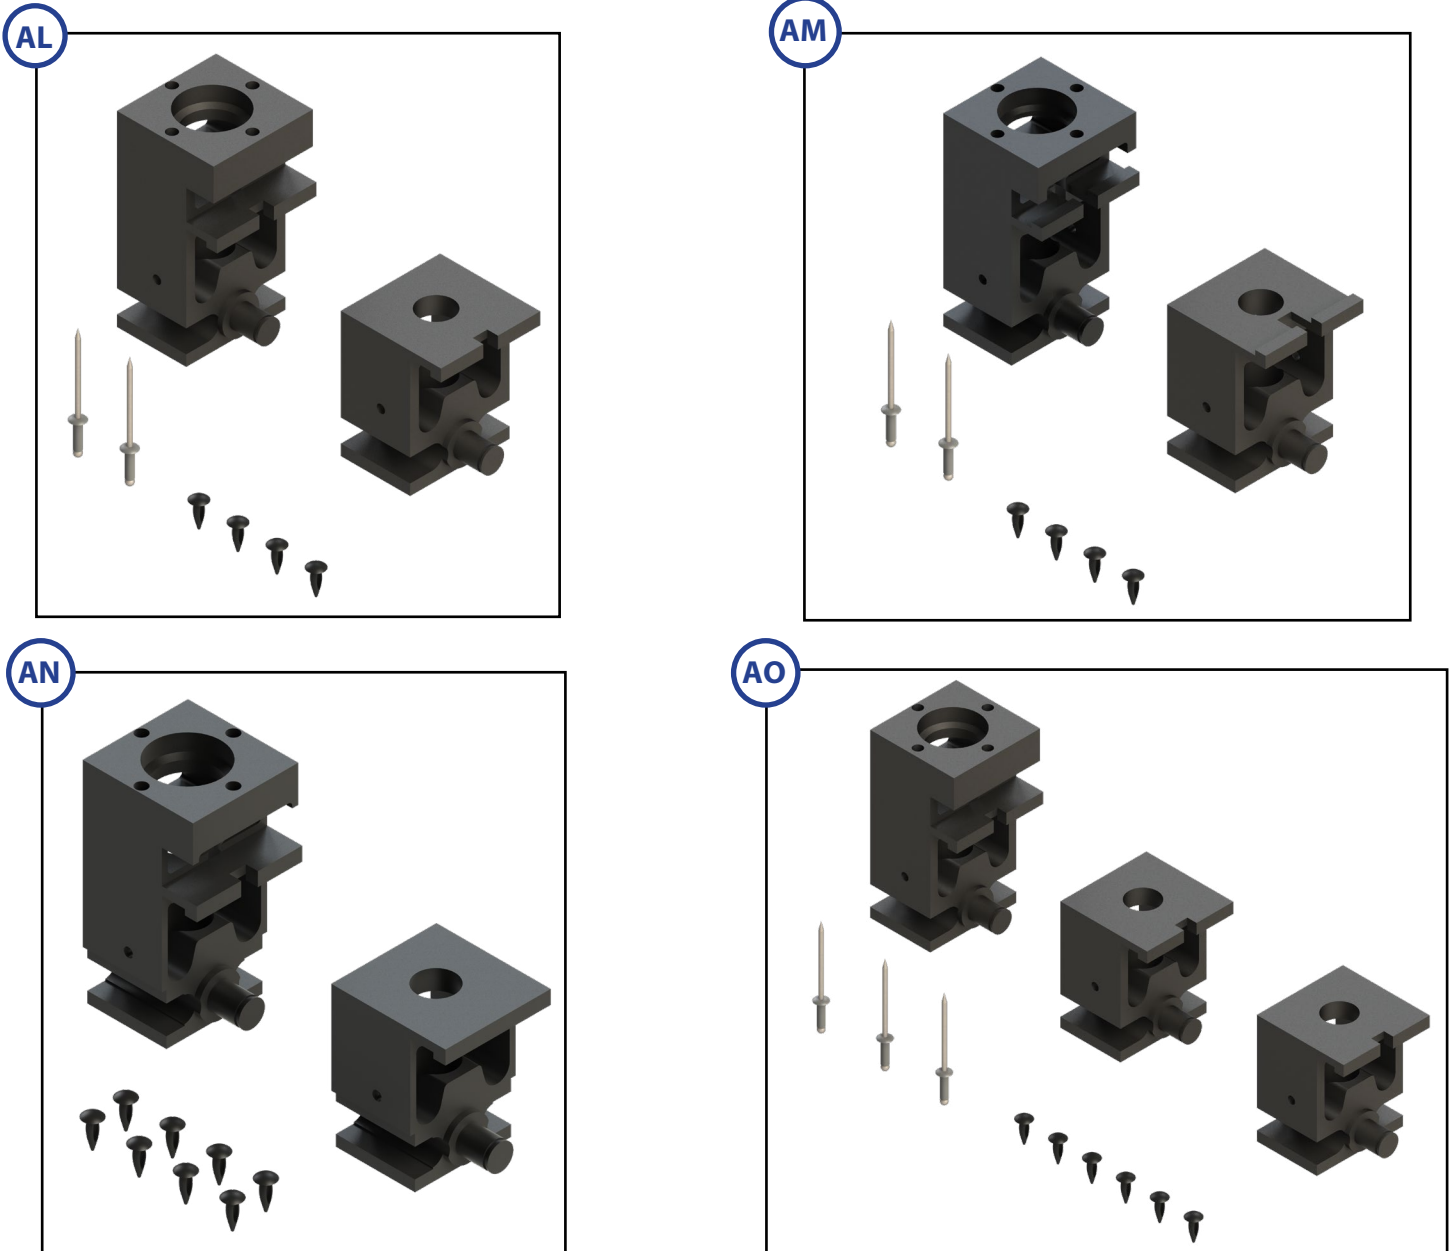


Callout	Part #	Description
AL	379060	Standard Bearing Block Repair Kit
AM	379076	Inverted Bearing Block Repair Kit
AN	379077	Narrow Bearing Block w/ Composite Gibs Repair Kit
AO	379720	Triple Bearing Block Repair Kit

Custom

If the system being repaired has a different notch than the standard 1.56", use the images below to identify the notch, then contact LCI Parts at (574) 537-8900 for ordering assistance. (See next page for kit numbers.)


NOTE: If the gear rack being replaced has notches on both ends, the rack will need to be custom ordered. Contact LCI Parts at (574) 537-8900 for ordering assistance.

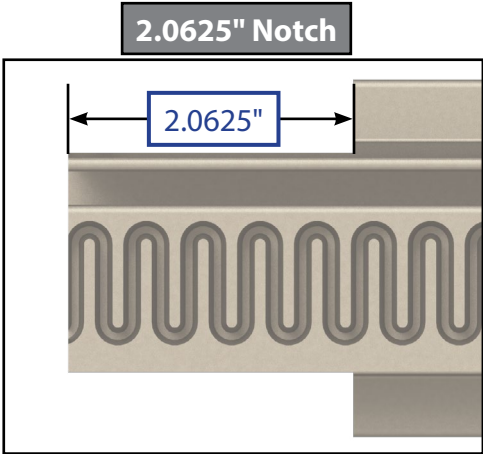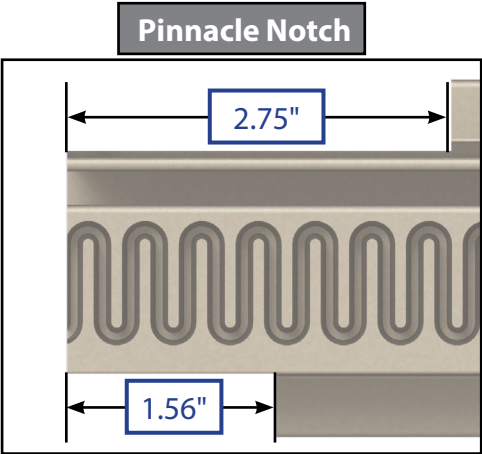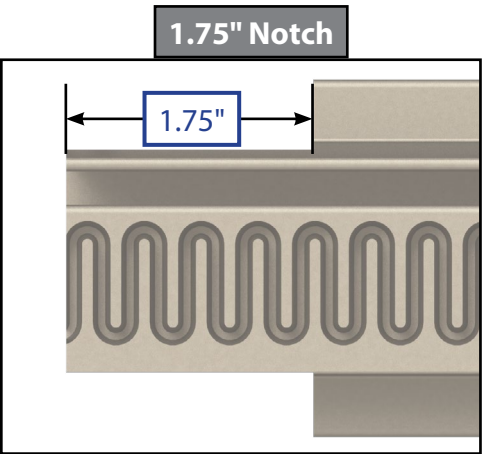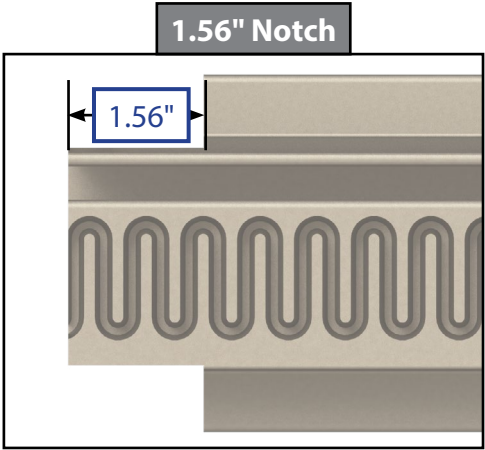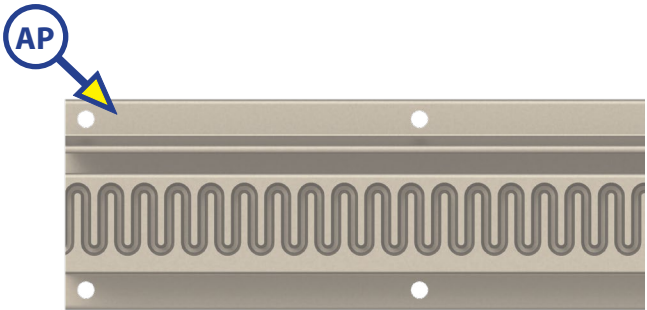

Callout	Part #	Description
AP	268774	Upper Flat Hook (Fixed and Float)
		1.56" Notch
		1.75" Notch
		Pinnacle Notch
		2.0625" Notch

IN-WALL® SLIDE-OUT COMPONENTS

SLIDE-OUTS

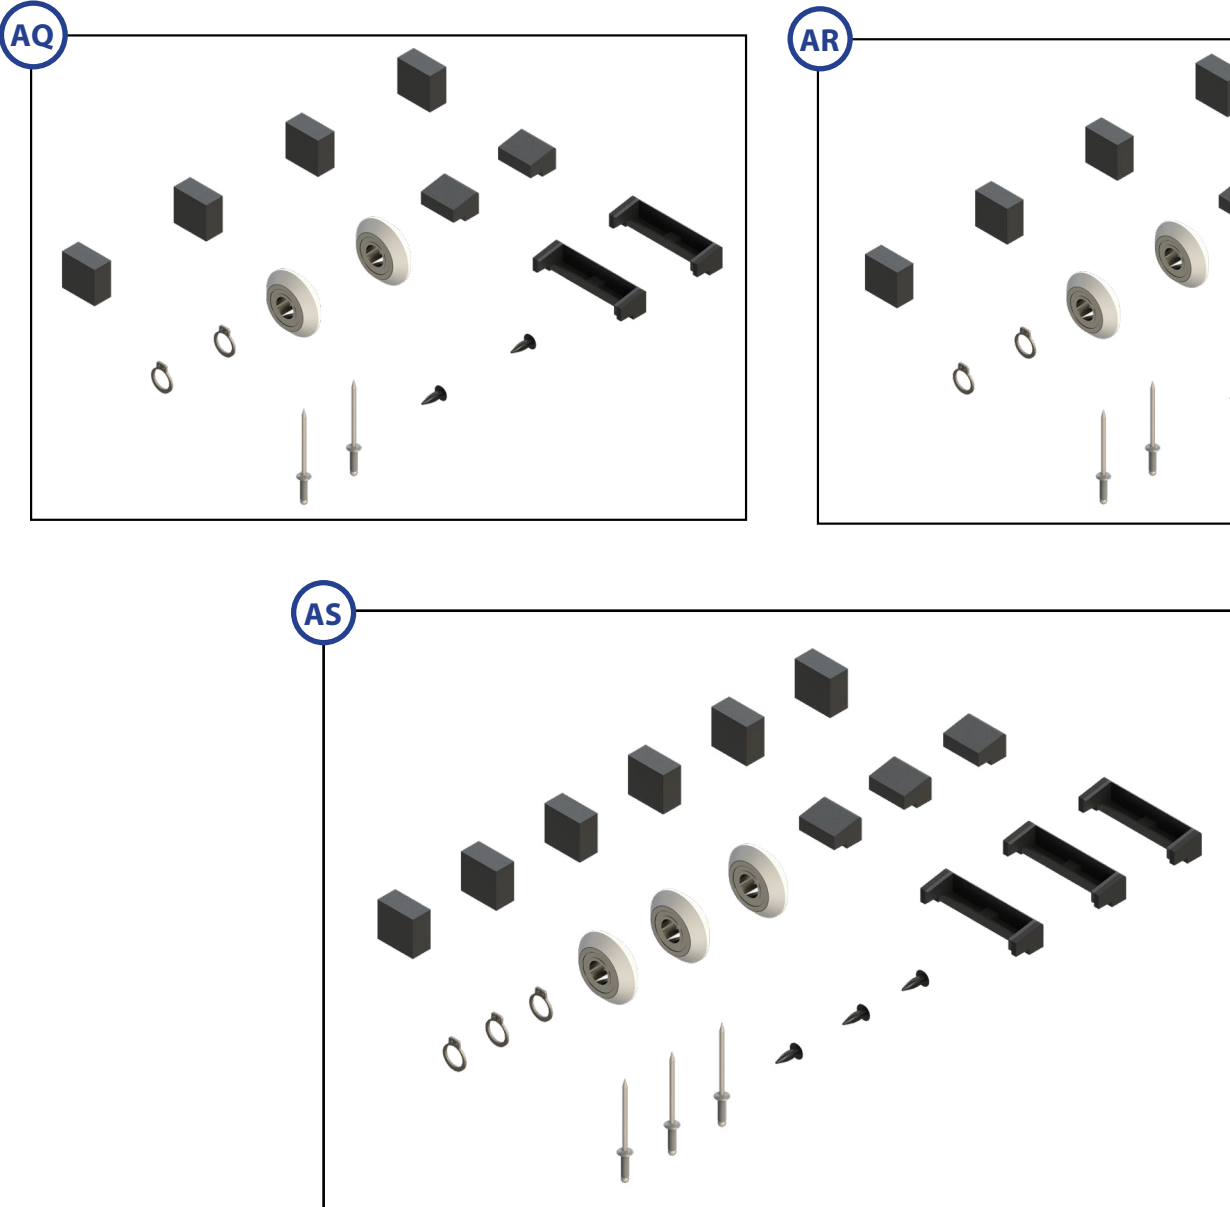

Callout	Part #	Description
AQ	366121	Standard (without gear racks)
AR	366120	Inverted (without gear racks)
AS	366106	Triple (without gear racks)



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.