


MOR/ryde “RL” Lateral Control Replacement Instructions



**MOR/ryde International
1966 Moyer Avenue
Elkhart, IN. 46516
574-293-1581**

www.morryde.com

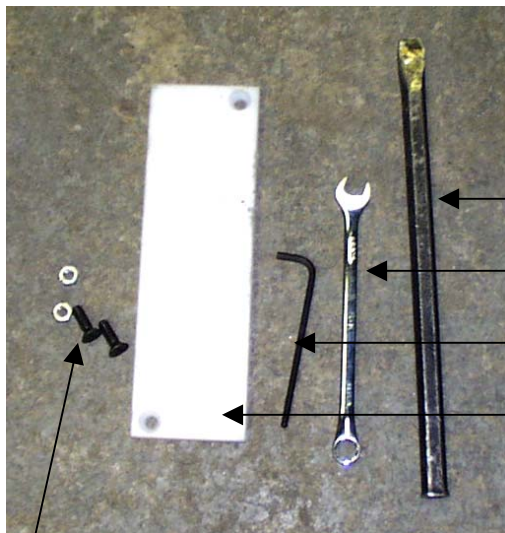

These are the components that are involved in the replacement of the lateral control.


Pry bar.

1/2" wrench

3/16" Allen wrench

Glide Pad

5/16" socket head bolts and nuts.

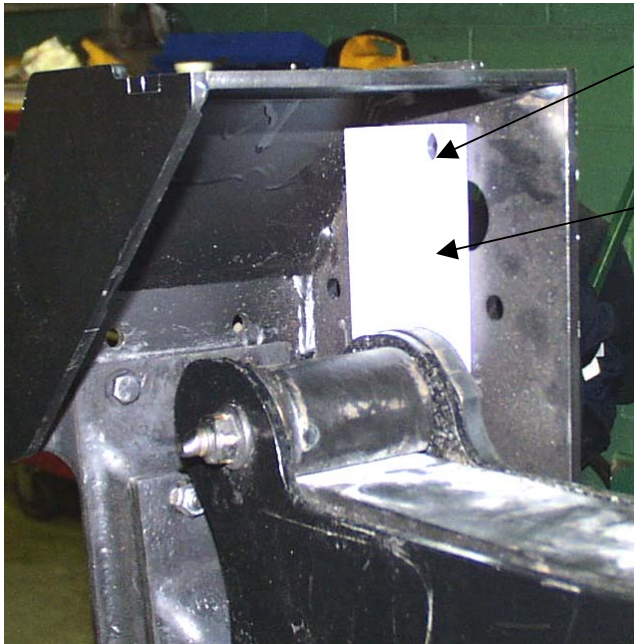


There is an Allen head bolt at the top to be removed. Hold the nut with a 1/2" end wrench.

This is the lateral control part (Glide Pad) to be removed.

The Allen wrench will need to be shortened to get into the bottom bolt. Grind about half of the length of the short end of the wrench off. It will help to pry the rubber shear spring over, away from the Glide Pad to get more room between the rubber and the Glide Pad. This can also be done with a Porta-Power inserted between the frame hanger and the leaf spring.

Once the Glide pad has been removed, reverse the procedure to reinstall the new parts.

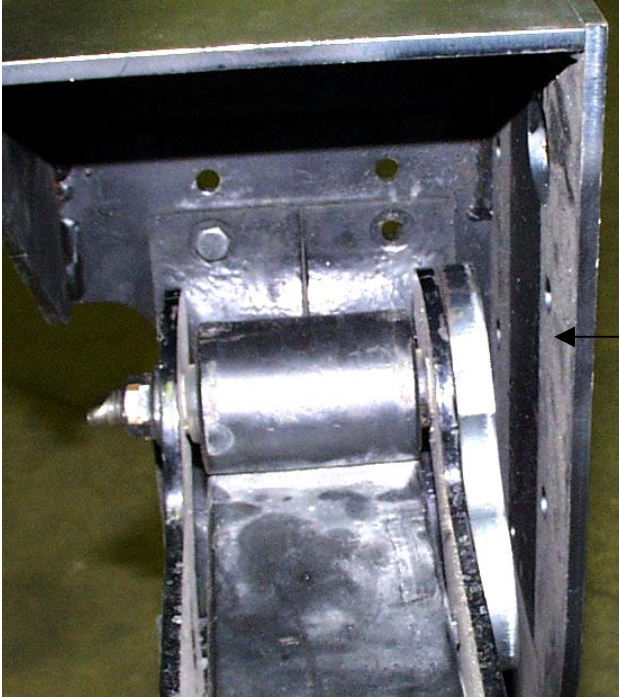

This picture shows the Glide pad removed.

← This is the area that the new Glide Pad will be reinstalled.



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.