


HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

NOTE: This document supersedes the previously-released versions dated June 29, 2021 and Aug. 12, 2021. All part numbers highlighted in blue have been updated from original version. All items highlighted in yellow have been updated from Aug. 12, 2021 version.

Subject

Inspection of the seal between the glass and frame on the following Hehr 6400 Series windows manufactured between October 1, 2018 and August 13, 2020.

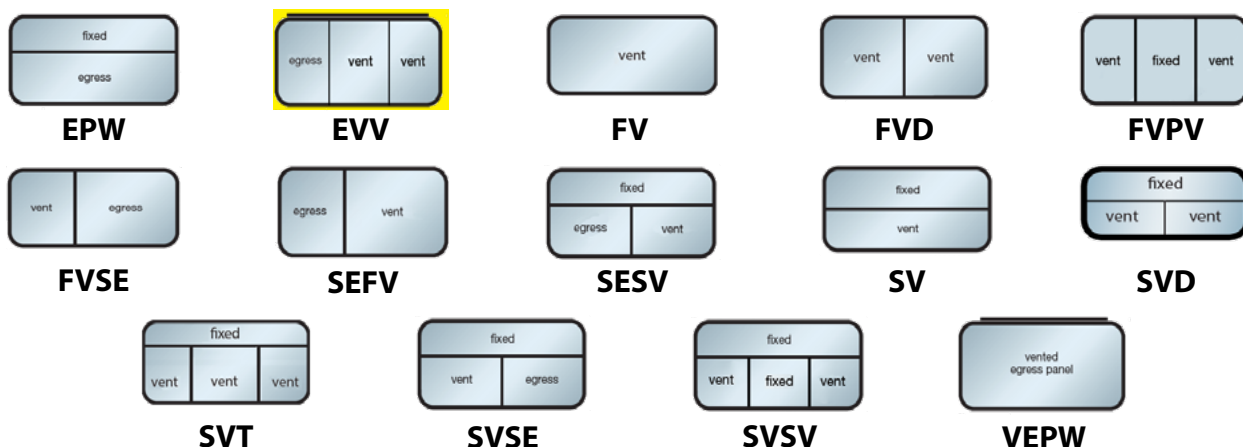

Safety

This document provides general instructions. Many variables can change the circumstances of any procedure, i.e. the degree of difficulty involved in the service operation and the ability level of the individual performing the operation. This document cannot begin to plot out procedures for every possibility, but will provide the general instructions for effectively installing, removing or servicing the system. In the event the skill level required is too advanced or the procedure too difficult, a certified technician should be consulted before performing the necessary operation. Failure to correctly install, remove or service the system may result in voiding the warranty, inflicting injury or even death.

WARNING

The "WARNING" symbol above is a sign that a procedure has a safety risk involved and may cause death, serious personal injury, severe product and/or property damage if not performed safely and within the parameters set forth in this document.

CAUTION

The "CAUTION" symbol above is a sign that a procedure has a safety risk involved and may cause personal injury, product and/or property damage if not performed safely and within the parameters set forth in this document.

Resources Required

- Cordless or electric drill or screw gun
- Phillips screw bit
- 3/16" drill bit
- Pop rivet gun
- Ladder
- Gauge kit: Part Number 2021094575

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

Window Identification

Window Size

Window Size ____ X ____ = from inside trim ring RPO label or measure outside the whole/entire window
Width X Height of glass, edge-to-edge.

Egress Windows

- A. Inside the unit an EXIT sticker (Fig. 1) or red handle (Fig. 2A) will be present.
- B. Outside the unit the white backside of the EXIT sticker will be visible.

Insulated Windows

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) or a super spacer (Fig. 4) sandwiched between two panes of glass can be seen.
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3) is seen.

Egress and Insulated

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) can be seen or the super spacer (Fig. 4) sandwiched between two panes of glass will be visible in addition to the EXIT sticker (Fig. 1) or red handle (Fig. 2A).
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3) can be seen located above the white backside of the EXIT sticker (Fig. 1).

Fig. 1



Fig. 2

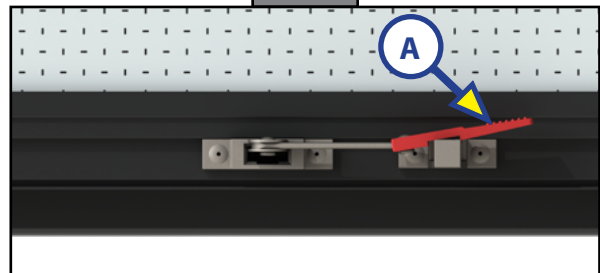


Fig. 3



Fig. 4



HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

Inspection

The provided gauge has a colored segment at one end (Fig. 5). Use the gauge as outlined in the instructions below to determine any possible break in the seal.

1. Be sure window is in closed position.
2. Lightly insert the gauge into the gap between the glass and the frame (Fig. 6) starting near the hinge on the exterior side of the window.
3. The gauge should stop within the colored segment (Fig. 7).
4. Continue reinserting the gauge at different points, working around the glass.

NOTE: If the gauge inserts beyond the colored segment (Fig. 8) this indicates a possible break in the seal and the vent of the window will need replacing.

Fig. 5



Fig. 6



Fig. 7



Fig. 8



HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

Required Vent Replacement Documents

<https://lci-support-doc.s3.amazonaws.com/technical-information-sheets/windows/ccd-0003876.pdf>

<https://lci-support-doc.s3.amazonaws.com/technical-information-sheets/windows/ccd-0003877.pdf>

Action Required

Submit all claims to RV OEM.

Inspection: 0.4 hour per unit

Replacement: 0.5 hour per vent

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent


Variant Codes

In each chart, the vent variant code part numbers and descriptions will be indented under the window variant code part number and description.

fixed egress 6400 EPW Window Variants	
Part Number	Description
V000486280	6403 EPW 36 X 24 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
782312	VENT / EXIT 6403-30 EPW 36.0 X 170 BK TP G20 4.000 RADII
V000486504	6423 EPW 36 X 26 X 17 G20 TP INS BK W/SCR N 3.1875 RADII
2020126682	VENT/EXIT 6423-30 EPW 36.0 X 170 BK TP G20 4.000 RADII
V000486274	6403 EPW 27.4 X 25.2 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
2020222310	VENT / EXIT 6403-30 EPW 27.4 X 170 BK TP G20 4.000 RADII
V000486279	6403 EPW 34 X 52 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
2020131438	VENT / EXIT 6403-30 EPW 34.0 X 17.0 BK TP G20 4.000 RADII
V000486272	6403 EPW 27 X 35 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
808835	VENT / EXIT 6403-30 EPW 27.0 X 170 BK TP G20 4.000 RADII
V000495556	6403 EPW 37 X 39.5 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
2021097038	VENT / EXIT 6403-30 EPW 37.0 X 17.0 BK TP G20 4.000 RADII
V000496631	6423 EPW 37.3 X 40 X 17 G20 TP INS BK W/SCR N 3.1875 RADII
2021097081	VENT EXIT 6423-30 EPW 37.3 X 17.0 BK TP G20 4.000 RADII
V000486284	6403 EPW 37.3 X 40 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
771648	VENT / EXIT 6403-30 EPW 37.3 X 170 BK TP G20 4.000 RADII
V000486270	6403 EPW 27 X 33 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
808835	VENT / EXIT 6403-30 EPW 27.0 X 170 BK TP G20 4.000 RADII
V000486276	6403 EPW 30 X 24 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
801590	VENT / EXIT 6403-30 EPW 30.0 X 170 BK TP G20 4.000 RADII
V000486269	6403 EPW 27 X 27 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
808835	VENT / EXIT 6403-30 EPW 27.0 X 170 BK TP G20 4.000 RADII
V000486271	6403 EPW 27 X 35 X 17 SCG TP INS BK NO SCR N 3.1875 RADII
2021106192	VENT / EXIT 6403-30 EPW 27.0 X 170 BK SCG TP 4.000 RADII
V000486275	6403 EPW 30 X 24 X 17 SCG TP INS BK NO SCR N 3.1875 RADII
2021106196	VENT / EXIT 6403-30 EPW 30.0 X 170 BK SCG TP 4.000 RADII
V000486277	6403 EPW 30 X 32 X 17 G20 TP INS BK NO SCR N 3.1875 RADII
801590	VENT / EXIT 6403-30 EPW 30.0 X 170 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 EPW Window Variants

Part Number	Description
V000486278	6403 EPW 34 X 36 X 17 G20 TP INS BK NO SCRN 3.1875 RADII
2020131438	VENT / EXIT 6403-30 EPW 34.0 X 17.0 BK TP G20 4.000 RADII
V000486502	6423 EPW 27 X 33 X 17 G20 TP INS BK W/SCRN 3.1875 RADII
2020111081	EXIT/VENT 6423-30 27.0 X 33.0 X 17.0 BK TP G20 4.000 RADII
V000500725	6403 EPW 42 X 26 X 17 G20 TP INS BK NO SCRN 3.1875 RADII
796079	VENT / EXIT 6403-30 EPW 42.0 X 17.0 BK TP G20 4.000 RADII
V000522568	6403 EPW 27 X 32 X 17 G20 TP INS BK NO SCRN 3.1875 RADII
808835	VENT / EXIT 6403-30 EPW 27.0 X 17.0 BK TP G20 4.000 RADII
V000527298	6423 EPW 36 X 45 X 17 G20 TP INS BK W/SCRN 3.1875 RADII
2020126682	VENT/EXIT 6423-30 EPW 36.0 X 17.0 BK TP G20 4.000 RADII



6400 EVV Window Variants

Part Number	Description
757126	1-6499-00-0-215-715-000-0-3535-0111-0284
794943	6499-0284 SPECIAL SHAPE 72.0 X 22.0 BK P VNT TP INS 1/8 G20 4.000 RADII
2021099711	RIGHT VENT 6499-30-R-0284 SPECIAL SHAPE 72.0 X 22.0 G20 TP INS BK 4.000 RADII
2021098471	CENTER VENT 6499-30-C-0284 SPECIAL SHAPE 72.0 X 22.0 G20 TP INS BK 4.000 RADII

NOTE: EVV window icon changed to Egress-Vent-Vent.

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent 6400 FV Window Variants	
Part Number	Description
V000486606	6451 FV 36.3 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096780	VENT 6451-40 FV 36.3 X 20.3 BK TP G20 4.000 RADII
V000490365	6451 FV 24 X 14 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096781	VENT 6451-40 FV 24.0 X 14.0 BK TP G20 4.000 RADII
V000486550	6451 FV 24 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
789116	6451 FV 24.0 X 15.0 BK Y VNT TP INS G20 4.000 RADII
V000486597	6451 FV 36 X 18 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020134495	VENT / ELEVATED 6451-40-E FV 36.0 X 18.0 BK TP G20 4.000 RADII
V000486513	6451 FV 16.1 X 24 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111562	6451-40-Y FV VENT (TRI-SEAL) 16.1 X 24.0 BK TP G20 4.000 RADII
V000486573	6451 FV 28.2 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021026886	VENT / ELEVATED 6451-40-E FV 28.0 X 12.0 BK G20 TP 4.000 RADII
V000486517	6451 FV 17 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096782	VENT 6451-40 FV 17.0 X 12.2 BK TP G20 4.000 RADII
V000486588	6451 FV 30 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096783	VENT 6451-40 FV 30.0 X 24.0 BK TP G20 4.000 RADII
V000486556	6451 FV 24 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020124800	6451-40-235-235-3535-9331
V000486519	6451 FV 18 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096785	VENT 6451-40 FV 18.0 X 18.0 BK TP G20 4.000 RADII
V000486541	6451 FV 18.3 X 26.4 G205 TP INS BK SKB W/SCRN 3.1875 RADII
790786	6451 FV 18.3 X 26.4 BK VNT TP INS G20 4.000 RADII
757121	1-6499-00-0-215-355-000-0-3535-0111-0175
2021097097	VENT EXIT 6499-30-0175 VEPW 36.0 X 22.0 BK TP G20 4.000 RADII
V000486529	6451 FV 18.1 X 31.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104689	VENT ONLY 6402-40 18.1 X 31.3 G20 TP INS BK 4.000 RADII
V000486543	6451 FV 21.2 X 12.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
786883	6451-40-117-207-3535-9331
V000486599	6451 FV 36 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096794	VENT 6451-40 FV 36.0 X 22.0 BK TP G20 4.000 RADII
V000486547	6451 FV 24 X 15 G20 TP INS BK SKB W/SCRN 3.1875 RADII
789116	6451 FV 24.0 X 15.0 BK Y VNT TP INS G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent 6400 FV Window Variants (Cont'd)	
Part Number	Description
V000486509	6451 FV 15.3 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
774071	6451 FV 15.3 X 20.3 BK VNT TP INS 1/8" G20 1/8" CL 4.000 RADII
V000494872	6451 FV 30.2 X 15.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
757151	1-6499-00-0-235-355-170-E-3535-0111-0020
V000486590	6451 FV 32 X 14 G205 TP INS BK SKB W/SCRN 3.1875 RADII
859265	VENT 6451-40 32.0 X 14.0 BK TP G20 4.000 RADII
V000486521	6451 FV 18 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
798327	6451 FV 18.0 X 24.0 BK VNT TP INS 1/8 G20 4.000 RADII
V000486545	6451 FV 22.6 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020043704	VENT ONLY 6451-40 22.6 X 26.0 G20 TP INS BK 4.000 RADII
V000486575	6451 FV 28.2 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
790665	6451 FV 28.2 X 18.0 BK VNT TP INS G20 4.000 RADII
V000486530	6451 FV 18.1 X 31.3 G20/OBS TP INS BK SKB W/SCRN 3.1875 RADII
2020104689	VENT ONLY 6402-40 18.1 X 31.3 G20 TP INS BK 4.000 RADII
V000486602	6451 FV 36 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111903	VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII
V000486577	6451 FV 28.2 X 23 G20 TP INS BK SKB W/SCRN 3.1875 RADII
772251	6451 FV 28.2 X 23.0 BK VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000486571	6451 FV 27 X 26 G20/OBS TP INS BK SKB W/SCRN 3.1875 RADII
810406	6451 VENT FV 27.0 X 26.0 BK TP G20 4.000 RADII
V000486594	6451 FV 36 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096795	VENT 6451-40 FV 36.0 X 18.0 BK TP G20 4.000 RADII
V000486566	6451 FV 27 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
813290	VENT 6451-40 27.0 X 20.3 BK TP G20 4.000 RADII
V000486533	6451 FV 18.2 X 24.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
803937	6451 FV 18.2 X 24.2 BK VNT TP INS 1/8 OBS 4.000 RADII
V000486527	6451 FV 18 X 36 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096795	VENT 6451-40 FV 36.0 X 18.0 BK TP G20 4.000 RADII
V000486582	6451 FV 30 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
793440	6451 FV 18.0 X 30.0 BK TP INS 1/8 G20 4.000 RADII
V000509695	6451 FV 32 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
799859	6451 FV 32.0 X 18.0 BK TP INS 1/8 G20 4.000 RADII


HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent 6400 FV Window Variants (Cont'd)	
Part Number	Description
V000489551	6451 FV 20 X 15 G20 TP INS BK SKB W/SCRN 3.1875 RADII
796536	6451 FV 20.0 X 15.0 BK TP INS 1/8" G20 4.000 RADII
V000494215	6451 FV 32 X 14 G20 TP INS BK SKB W/SCRN 3.1875 RADII
859265	VENT 6451-40 32.0 X 14.0 BK TP G20 4.000 RADII
V000497290	6451 FV 27 X 26 G205/OBS TP INS BK SKB W/SCRN 3.1875 RADII
810406	6451 VENT FV 27.0 X 26.0 BK TP G20 4.000 RADII
V000501972	6451 FV 30 X 14 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106313	VENT ONLY 6451-40 FV 30.0 X 14.0 BK G20 TP 4.000 RADII
V000531259	6451 FV 28 X 16 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021025706	VENT ONLY 6451-40 FV 28.0 X 16.0 G20 TP BK 4.000 RADII
V000538652	6451 FV 30 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098119	VENT / ELEVATED 6451-40-Y FV 30.0 X 22.0 BK TP G20 4.000 RADII
V000552759	6451 FV 26.6 X 31.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106359	VENT ONLY 6451-40 FV 26.6 X 31.2 BK G20 TP 4.000 RADII
V000556661	6451 FV 24 X 24 G20 TP INS BK TKB W/SCRN 3.1875 RADII
2020102083	VENT ONLY 6451-40 16.1 X 24.0 G20 TP INS BK 4.000 RADII
V000557606	6451 FV 22 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106362	VENT ONLY 6451-40 FV 22.0 X 26.0 BK G20 TP 4.000 RADII
V000558761	6451 FV 27 X 30 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106363	VENT ONLY 6451-40 FV 27.0 X 30.0 BK G20 TP 4.000 RADII
V000559036	6451 FV 30 X 24 G20 TP INS BK TKB W/SCRN 3.1875 RADII
2021096783	VENT 6451-40 FV 30.0 X 24.0 BK TP G20 4.000 RADII
V000565941	6451 FV 24 X 12.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106685	VENT ONLY 6451-40 FV 24.0 X 12.3 BK G20 TP 4.000 RADII
V000601054	6451 FV 32 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098134	VENT / ELEVATED 6451-40-Y FV 32.0 X 15.0 BK TP G20 4.000 RADII
V000509695	6451 FV 32 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
799859	6451 FV 32.0 X 18.0 BK TP INS 1/8 G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 FVD Window Variants (Cont'd)

Part Number	Description
V000486664	6452 FVD 48 X 24 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111080	Z-VENT 6452-40-Z 48.0 X 24.0 BK TP G20 4.000 RADII
771877	X-VENT 6452-40-X 48.0 X 24.0 BK TP G20 4.000 RADII
V000486642	6452 FVD 48 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020000147	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
2020002736	LEFT VENT 6452-40 48.0 X 15.0 G20 TP INS BK 4.000 RADII
V000486610	6452 FVD 36 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
804557	6452 FVD 36.0 X 24.0 BK R VNT TP INS 1/8" G20 4.000 RADII
804558	6452 FVD 36.0 X 24.0 BK P VNT TP INS 1/8" G20 4.000 RADII
V000486690	6452 FVD 60 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020220003	VENT / LEFT 6452-40-P FVD 60.0 X 26.0 BK TP G20 4.000 RADII
790662	6452 FVD 60.0 X 26.0 BK R VNT TP INS G20 4.000 RADII
V000486630	6452 FVD 42 X 26.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096822	VENT RIGHT 6452-40-R FVD 42.0 X 26.3 BK TP G20 4.000 RADII
2021096823	VENT LEFT 6452-40-P FVD 42.0 X 26.3 BK TP G20 4.000 RADII
V000487703	6452 FVD 72 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020125840	X-VENT 6452-40-X FVD 72.0 X 15.0 BK TP G20 4.000 RADII
811928	Z-VENT 6452-40-Z FVD 72.0 X 15.0 BK TP G20 4.000 RADII
V000486675	6452 FVD 54 X 25 G20 TP INS BK SKB W/SCRN 3.1875 RADII
802692	6452-40-245-535-R-3535-9331
806698	6452-40-245-535-P-3535-9331
V000486686	6452 FVD 60 X 22 G205 TP INS BK SKB W/SCRN 3.1875 RADII
2021096819	VENT RIGHT 6452-40-R FVD 60.0 X 22.0 BK TP G20 4.000 RADII
2021096821	VENT LEFT 6452-40-P FVD 60.0 X 22.0 BK TP G20 4.000 RADII
V000486624	6452 FVD 42 X 15 G20 PT INS BK EL OP SKB W/SCRN 3.1875 RADII
802961	VENT/RIGHT/ ELEVATED, 6452-40-Z FVD 42.0 X 15.0 BK TP G20 4.000 RADII
852250	X-VENT 6452 42.0 X 15.0 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 FVD Window Variants (Cont'd)

Part Number	Description
V000486655	6452 FVD 48 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
770490	3-6452-40-0-215-475-000-Z-3535-9331-0000
797455	6452 FVD 48.0 X 22.0 BK P VNT TP INS 1/8 G20 4.000 RADII
V000492706	6452 FVD 70 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020125840	X-VENT 6452-40-X FVD 72.0 X 15.0 BK TP G20 4.000 RADII
811928	Z-VENT 6452-40-Z FVD 72.0 X 15.0 BK TP G20 4.000 RADII
V000486619	6452 FVD 40 X 16 G20 TP INS BK SKB W/SCRN 3.1875 RADII
770213	3-6452-40-0-155-395-000-R-3535-9331-0000
772789	6452 FVD 40.0 X 16.0 BK P VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000486660	6452 FVD 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
788995	6452 FVD 48.0 X 24.0 BK R VNT INS TP 5/32 G20 4.000 RADII
788996	6452 FVD 48.0 X 24.0 BK P VNT INS TP 5/32 G20 4.000 RADII
V000494765	6452 FVD 64 X 26.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
798960	6452 FVD 64.0 X 26.2 BK R VNT TP INS 1/8 G20 4.000 RADII
782314	6452 FVD 64.0 X 26.2 BK P VNT TP INS 1/8" G20 SC 1/8" CL 4.000 RADII
V000486667	6452 FVD 48 X 26 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021099708	LEFT VENT 6452-40-P 48.0 X 26.0 G20 TP INS BK 4.000 RADII
771110	6452 FVD 48.0 X 26.0 BK R VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000492679	6452 FVD 53.7 X 26.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096826	VENT RIGHT 6452-40-R FVD 53.7 X 26.2 BK TP G20 4.000 RADII
2021096827	VENT LEFT 6452-40-P FVD 53.7 X 26.2 BK TP G20 4.000 RADII
V000486682	6452 FVD 58 X 15.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096829	VENT RIGHT 6452-40-R FVD 58.0 X 15.1 BK TP G20 4.000 RADII
2021096830	VENT LEFT 6452-40-P FVD 58.0 X 15.1 BK TP G20 4.000 RADII
V000495345	6452 FVD 60 X 20 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096833	VENT RIGHT 6452-40-R FVD 60.0 X 20.0 BK TP G20 4.000 RADII
2021096837	VENT LEFT 6452-40-P FVD 60.0 X 20.0 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

6400 FVD Window Variants (Cont'd)

Part Number	Description
V000487701	6452 FVD 60 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020105304	6452-40-145-595-X-3535-9331
811313	6452-40-145-595-Z-3535-9331
V000486684	6452 FVD 58 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
796984	6452 FVD 58.0 X 24.0 BK P VNT TP INS 1/8 G20 4.000 RADII
794945	6452 FVD 58.0 X 24.0 BK R VNT TP INS 1/8 G20 4.000 RADII
V000486671	6452 FVD 48 X 30 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096824	VENT RIGHT 6452-40-R FVD 48.0 X 30.0 BK TP G20 4.000 RADII
2021096825	VENT LEFT 6452-40-P FVD 48.0 X 30.0 BK TP G20 4.000 RADII
V000486669	6452 FVD 48 X 28 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020101527	RIGHT VENT ONLY 6452-40 48.0 X 28.0 G20 INS TP BK 4.000 RADII
2020329390	VENT / LEFT 6452-40-P FVD 48.0 X 28.0 G20 TP BK 4.000 RADII
V000486633	6452 FVD 44 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020220005	VENT / RIGHT 6452-40-R FVD 44.0 X 24.0 BK TP G20 4.000 RADII
2020220007	VENT / LEFT 6452-40-P FVD 44.0 X 24.0 BK TP G20 4.000 RADII
V000486688	6452 FVD 60 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020220008	VENT / RIGHT 6452-40-R FVD 60.0 X 22.3 BK TP G20 4.000 RADII
2020220009	VENT / LEFT 6452-40-P FVD 60.0 X 22.3 BK TP G20 4.000 RADII
V000486638	6452 FVD 46 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106207	LEFT VENT ONLY 6452-40-P FVD 46.0 X 18.0 BK G20 TP 4.000 RADII
2021106205	RIGHT VENT ONLY 6452-40-R FVD 46.0 X 18.0 BK G20 TP 4.000 RADII
V000486680	6452 FVD 54 X 28 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106212	LEFT VENT ONLY 6452-40-P FVD 54.0 X 28.0 BK G20 TP 4.000 RADII
2021106209	RIGHT VENT ONLY 6452-40-R FVD 54.0 X 28.0 BK G20 TP 4.000 RADII
V000487705	6452 FVD 68 X 26.2 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020043703	RIGHT VENT ONLY 6452-40 68.0 X 26.2 G20 TP INS BK 4.000 RADII
771111	6452 FVD 68.0 X 26.2 BK P VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000550793	6452 FVD 60 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096817	VENT RIGHT 6452-40-R FVD 60.0 X 22.0 BK TP G20 4.000 RADII
2021096818	VENT LEFT 6452-40-P FVD 60.0 X 22.0 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent vent 6400 FVD Window Variants (Cont'd)	
Part Number	Description
V000558956	6452 FVD 60 X 16 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106368	LEFT VENT ONLY 6452-40-P FVD 60.0 X 16.0 BK G20 TP 4.000 RADII
2021106365	RIGHT VENT ONLY 6452-40-R FVD 60.0 X 16.0 BK G20 TP 4.000 RADII
V000581056	6452 FVD 47.4 X 27.4 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106422	VENT / LEFT 6404-40-P FVD 47.4X 27.4 BK G20 TP 4.000 RADII
2021106421	VENT / RIGHT 6452-40-R FVD 47.4 X 27.4 BK G20 TP 4.000 RADII
V000597486	6452 FVD 54 X 15 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098470	RIGHT VENT 6452-40-Z 54.0 X 15.0 G20 TP INS BK 4.000 RADII
2021106423	VENT / LEFT / ELEVATED 6452-40-X FVD 47.4 X 27.4 BK G20 TP 4.000 RADII

vent fixed vent 6400 FVPV Window Variants	
Part Number	Description
803665	6499 FVPV 84 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021105005	LEFT VENT ONLY 6499-40-P-0516 84.0 X 22.3 G20 TP BK 4.000 RADII
2021106164	RIGHT VENT ONLY 6499-40-R-0516 84.0 X 22.3 BK G20 TP 4.000 RADII
2021106166	CENTER VENT ONLY 6499-40-C-0516 84.0 X 22.3 BK G20 TP 0.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL


Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent egress 6400 FVSE Window Variants	
Part Number	Description
V000487728	6475 FVSE 64 X 32 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
863134	6475-46-315-635-P-3535-9331
2021027604	LEFT VENT 6475-46-P FVSE 58.0 X 24.0 G20 TP BK 4.000 RADII
V000486869	6475 FVSE 58 X 24 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
2021027604	6475-46-235-575-P-3535-9331
2021097008	VENT / EXIT / RIGHT 6475-36-R SVSE 58.0 X 24.0 BK TP G20 4.000 RADII
V000486865	6475 FVSE 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021097010	VENT / LEFT 6475-40-P SVSE 48.0 X 24.0 BK TP G20 4.000 RADII
2021097011	VENT / EXIT / RIGHT 6475-30-R SVSE 48.0 X 24.0 BK TP G20 4.000 RADII
V000488011	6475 FVSE 68 X 20 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
2021097012	VENT / LEFT 6475-46-P SVSE 68.0 X 20.0 BK TP G20 4.000 RADII
2021097014	VENT / EXIT / RIGHT 6475-36-R SVSE 68.0 X 20.0 BK TP G20 4.000 RADII
V000565703	6455 FVSE 42 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106372	VENT / LEFT / EXIT 6455-40-P SESV 42.0 X 22.0 BK G20 TP 4.000 RADII
2021106370	VENT / RIGHT / EXIT 6455-30-R SESV 42.0 X 22.0 BK G20 TP 4.000 RADII

6400 SEDV Window Variants	
Part Number	Description
V000569852	6474 SEFV 57 X 24 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098129	VENT / LEFT / PUSH BAR EXIT 6474-30-X SESV 57.0 X 24.0 BK TP G20 4.000 RADII
2021098130	VENT / RIGHT / ELEVATED 6474-40-Z SESV 57.0 X 24.0 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 SEFV Window Variants

Part Number	Description
V000486726	6454 SEFV 48 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020102131	LEFT EXIT VENT ONLY 6454-30 48.0 X 24.0 G20 TP INS BK 4.000 RADII
2020129480	VENT, RIGHT 6454-40-R 48.0 X 24.0 BK TP G20 4.000 RADII
V000486747	6454 SEFV 60 X 22 G205 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
2021096958	VENT / RIGHT 6454-46-R SESV 60.0 X 22.0 BK TP G20 4.000 RADII
2021096959	VENT / EXIT / LEFT 6454-36-P SESV 60.0 X 22.0 BK TP G20 4.000 RADII
V000486707	6454 SEFV 42 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096960	VENT / RIGHT 6454-40-R SESV 42.0 X 22.0 BK TP G20 4.000 RADII
2021096962	VENT / EXIT / LEFT 6454-30-P SESV 42.0 X 22.0 BK TP G20 4.000 RADII
V000486734	6454 SEFV 53.7 X 22.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096963	VENT / RIGHT 6454-40-R SESV 53.7 X 22.1 BK TP G20 4.000 RADII
2021096964	VENT / EXIT / LEFT 6454-30-P SESV 53.7 X 22.1 BK TP G20 4.000 RADII
V000486723	6454 SEFV 48 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020131878	VENT/RIGHT/ELEVATED 6454-40-Z 48.0 X 22.0 BK TP G20 4.000 RADII
862993	LEFT EXIT VENT 6454-30-P 48.0 X 22.0 G20 TP INS BK EL OP 4.000 RADII
757192	1-6499-00-0-260-415-000-0-3535-0111-0296
2020104690	6499-30-260-415-P-3535-9331-0296
792711	6499-40-260-415-R-3535-9331-0296
V000486715	6454 SEFV 42 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
806963	R VENT 6452 SESV 42.0 X 24.0 BK TP 1/8" G20 4.000 RADII
2021099709	LEFT VENT 6454-40-P 42.0 X 24.0 G20 TP INS BK 4.000 RADII
V000486711	6454 SEFV 42 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
787744	6454 SESV 42.0 X 22.3 BK R VNT TP INS G20 4.000 RADII
2021099710	LEFT VENT 6454-40-P 42.0 X 22.3 G20 TP INS BK 4.000 RADII
V000486741	6454 SEFV 60 X 26.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020002957	RIGHT VENT 6454-40 60.0 X 26.3 G20 TP INS BK 4.000 RADII
2020002958	LEFT VENT 6454-30 60.0 X 26.3 G20 TP INS BK 4.000 RADII
V000496255	6454 SEFV 44 X 24 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096965	VENT / RIGHT 6454-40-R SESV 44.0 X 24.0 BK TP G20 4.000 RADII
2021096974	VENT / EXIT / LEFT 6454-30-P SESV 44.0 X 24.0 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

vent egress 6400 SEFV Window Variants (Cont'd)	
Part Number	Description
757137	1-6499-00-0-220-715-000-0-3535-0111-0292
771095	6499-40-220-715-R-3535-9331-0292
852138	6499-40-220-715-P-3535-9331-0292
V000496413	6454 SEFV 60 X 20 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
2020129649	VENT/EXIT/LEFT, 6454-36-P 60.0 X 20.0 BK TP G20 4.000 RADII
2021099711	RIGHT VENT 6454-36-R 60.0 X 20.0 G20 TP INS BK 4.000 RADII
V000486703	6454 SEFV 42 X 20.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020121298	P-EXIT 6454-30 SESV 42.0 X 20.3 BK TP G20 4.000 RADII
790664	6454 SESV 42.0 X 20.3 BK R VNT TP INS G20 4.000 RADII
V000486737	6454 SEFV 60 X 22.3 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096975	VENT / RIGHT 6454-40-R SESV 60.0 X 22.3 BK TP G20 4.000 RADII
2021096976	VENT / EXIT / LEFT 6454-30-P SESV 60.0 X 22.3 BK TP G20 4.000 RADII
V000486718	6454 SEFV 48 X 22 G20 TP INS BK SKB W/SCRN 3.1875 RADII
770490	3-6452-40-0-215-475-000-Z-3535-9331-0000
797455	6452 FVD 48.0 X 22.0 BK P VNT TP INS 1/8 G20 4.000 RADII
V000493534	6474 SEFV 53.7 X 26.2 G20 EVEN TP INS BK SKB W/SCRN 3.1875 RADII
770355	3-6474-46-0-257-534-000-R-3535-9331-0000
862273	L EXIT VENT 6474-36 SEFV 53.7 X 26.2 BK TP G20 4.000 RADII
V000496411	6474 SEFV 60 X 20 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106302	VENT / LEFT / PUSH BAR EXIT 6474-30-P SESV 60.0 X 20.0 BK G20 TP 4.000 RADII
2021106306	VENT / RIGHT 6474-40-R SESV 60.0 X 20.0 BK G20 TP 4.000 RADII
V000568228	6454 SEFV 57 X 22 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098126	VENT / LEFT / EXIT / ELEVATED 6454-30-X SESV 57.0 X 22.0 BK TP G20 4.000 RADII
2021101585	VENT/RIGHT/ELEVATED 6454-40-Z 57.0 X 22.0 G20 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 SESV Window Variants

Part Number	Description
V000486313	6404 SESV 42 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
769667	VENT RIGHT 6404-40-R SESV 42.0 X 170 BK TP G20 4.000 RADII
2020001429	6404-30-000-415-170-P-3535-9331
V000486330	6404 SESV 48 X 29 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020106417	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000486329	6404 SESV 48 X 24 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020106417	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000486352	6404 SESV 60 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
800787	VENT RIGHT 6404-40-R SESV 60.0 X 170 BK TP G20 4.000 RADII
800786	VENT EXIT LEFT 6404-30-P SESV 60.0 X 170 BK TP G20 4.000 RADII
V000486330	6404 SESV 48 X 29 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020106417	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000486338	6404 SESV 48 X 33 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020106417	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000489502	6404 SESV 54 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021097057	VENT RIGHT 6404-40-R SESV 54.0 X 17.0 BK TP G20 4.000 RADII
2021097058	VENT EXIT LEFT 6404-30-P SESV 54.0 X 17.0 BK TP G20 4.000 RADII
V000486353	6404 SESV 60 X 38 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
800787	VENT RIGHT 6404-40-R SESV 60.0 X 170 BK TP G20 4.000 RADII
800786	VENT EXIT LEFT 6404-30-P SESV 60.0 X 170 BK TP G20 4.000 RADII
V000486325	6404 SESV 48 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
800888	VENT RIGHT 6404-40-R SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000486359	6404 SESV 64 X 34 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096963	VENT / RIGHT 6454-40-R SESV 53.7 X 22.1 BK TP G20 4.000 RADII
2021096964	VENT / EXIT / LEFT 6454-30-P SESV 53.7 X 22.1 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 SESV Window Variants (Cont'd)

Part Number	Description
757232	1-6499-00-0-325-355-170-E-3535-0111-0130
773380	6499 SESV 36.0 X 33.0 X 170 BK R VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
785737	6499 SESV 36.0 X 33.0 X 170 BK P EXIT VNT TP SC INS 1/8"G20 1/8" CL 4.000 RADII
757294	6499-0077 SESV 66.2 X 42.2 X 170 BK TP G20 3.188 RADII
2020043706	LEFT EXIT VENT ONLY 6499-30-0077 66.2 X 42.2 X 170 G20 TP INS BK 4.000 RADII
798916	3-6499-40-0-417-657-170-0-3535-9331-0077
V000486312	6404 SESV 42 X 24 X 17 SCG TP INS BK SKB W/SCRN 3.1875 RADII
2021106198	VENT / EXIT / LEFT 6404-30-P SESV 42.0 X 170 BK SCG TP 4.000 RADII
2021106203	VENT RIGHT 6404-40-R SESV 42.0 X 170 BK SCG TP 4.000 RADII
V000489548	6404 SESV 42 X 29 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001429	VENT EXIT LEFT 6404-30-P SESV 42.0 X 170 BK TP G20 4.000 RADII
769667	VENT RIGHT 6404-40-R SESV 42.0 X 170 BK TP G20 4.000 RADII
V000493487	6404 SESV 57 X 33 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021098104	VENT / RIGHT 6404-40-R SESV 57.0 X 170 BK TP G20 4.000 RADII
2021098106	VENT / LEFT / EXIT 6404-30-P SESV 57.0 X 170 BK TP G20 4.000 RADII
V000564622	6404 SESV 48 X 24 X 17 G20 TP INS BK TKB W/SCRN 3.1875 RADII
800888	VENT RIGHT 6404-40-R SESV 48.0 X 170 BK TP G20 4.000 RADII
812649	VENT EXIT LEFT 6404-30-P SESV 48.0 X 170 BK TP G20 4.000 RADII
V000574402	6404 SESV 48 X 36 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020106417	VENT ELEVATED RIGHT 6404-40-Z SESV 48.0 X 170 BK TP G20 4.000 RADII
2021106420	VENT / RIGHT 6404-40-R SESV 48.0 X 170 BK G20 TP 4.000 RADII


HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

fixed vent 6400 SV Window Variants	
Part Number	Description
V000486076	6401 SV 18 X 16 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020002384	VENT / ELEVATED 6401-40-Y SV 36.0 X 081 BK TP G20 4.000 RADII
V000486085	6401 SV 18 X 28 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111565	VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII
V000486095	6401 SV 24 X 18 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
805295	VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII
V000486096	6401 SV 24 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
805295	VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII
V000486100	6401 SV 24 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
805295	VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII
V000486132	6401 SV 30 X 30 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
786621	VENT / ELEVATED 6401-40-Y SV 30.0 X 081 BK TP G20 4.000 RADII
757204	1-6499-00-0-291-175-141-0-3535-5341-0209
789313	6499-0209 SPECIAL SHAPE 17.7 X 29.4 X 141 BK VNT INS TP GRN 4.000 RADII
V000486136	6401 SV 36 X 15.1 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020002384	VENT / ELEVATED 6401-40-Y SV 36.0 X 081 BK TP G20 4.000 RADII
757309	1-6499-00-0-475-265-170-0-3535-0111-0281
2021097090	VENT EXIT 6499-30-0281 EPW 27.0 X 48.0 X 17.0 BK TP G20 4.000 RADII
V000486104	6401 SV 24.2 X 18.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021097018	VENT ONLY 6401-40 SV 24.2 X 081 BK TP G20 4.000 RADII
V000486069	6401 SV 15.3 X 20.3 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
800802	VENT ONLY 6401-40 SV 15.3 X 081 BK TP G20 4.000 RADII
V000486099	6401 SV 24 X 29 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104607	VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII
V000486108	6401 SV 27 X 27 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
769675	VENT / ELEVATED 6401-40-Y SV 27.0 X 081 BK TP G20 4.000 RADII
V000486075	6401 SV 18 X 15 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111565	VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII
V000486083	6401 SV 18 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111565	VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII
V000486100	6401 SV 24 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
805295	VENT / ELEVATED 6401-40-Y SV 24.0 X 081 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SV Window Variants (Cont'd)

Part Number	Description
V000486133	6401 SV 30 X 35 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
786621	VENT / ELEVATED 6401-40-Y SV 30.0 X 081 BK TP G20 4.000 RADII
V000486079	6401 SV 18 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001431	6401-40-000-175-081-3535-9331
V000486111	6401 SV 27 X 35 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104608	6401-40-000-265-081-3535-9331
V000486124	6401 SV 30 X 20 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
812648	VENT ONLY 6401-40 SV 30.0 X 081 BK TP G20 4.000 RADII
757269	6499-0060 SPECIAL SHAPE 14.0 X 38.1 X 101 BK TP GRN 3.188 RADII
770606	3-6499-40-0-376-135-101-0-3535-0041-0060
757302	1-6499-00-0-455-155-170-0-3535-0111-0180
2021097140	VENT 6499-40-0180 SV 16.0 X 46.0 X 170 BK TP G20 4.000 RADII
V000493199	6401 SV 18 X 15.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000493195	6401 SV 36 X 15.1 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020101668	VENT ONLY 6401-40 SV 36.0 X 081 BK TP G20 4.000 RADII
V000487690	6401 SV 18 X 35 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000486081	6401 SV 18 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111565	6401-40-000-175-081-Y-3535-9331
V000486088	6401 SV 18 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000496288	6401 SV 18.1 X 36.7 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
800351	VENT ONLY 6401-40 SV 18.1 X 081 BK TP G20 4.000 RADII
V000486080	6401 SV 18 X 20 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
757113	1-6499-00-0-215-121-081-0-3535-0111-0321
2021097144	VENT ELEVATED 6499-40-Y-0321 SV 12.3 X 22.0 X 081 BK TP G20 4.000 RADII
V000486102	6401 SV 24 X 52.3 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104607	VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII
757116	1-6499-00-0-215-121-081-E-3535-0111-0321
2021097144	VENT ELEVATED 6499-40-Y-0321 SV 12.3 X 22.0 X 081 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SV Window Variants (Cont'd)

Part Number	Description
V000486110	6401 SV 27 X 33 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104608	VENT ONLY 6401-40 SV 27.0 X 081 BK TP G20 4.000 RADII
V000486098	6401 SV 24 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104607	VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII
V000497174	6401 SV 16 X 28 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
770214	VENT ONLY 6401-40 SV 16.0 X 081 BK TP G20 4.000 RADII
V000486519	6451 FV 18 X 18 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021096785	VENT 6451-40 FV 18.0 X 18.0 BK TP G20 4.000 RADII
757097	1-6499-00-0-195-295-000-0-3535-0111-0173
2021097124	VENT EXIT 6499-30-0173 VEPW 30.0 X 20.0 BK TP G20 4.000 RADII
757082	1-6499-00-0-165-165-050-0-3535-0111-0435
800803	6499-0435 SPECIAL SHAPE 17.0 X 17.0 X 050 BK VNT TP INS 1/8 G20 4.000 RADII
757142	1-6499-00-0-235-295-000-0-3535-0111-0300
2020003038	VENT ONLY 6499-30-0300 30.0 X 24.0 G20 TP INS BK 4.000 RADII
757266	WINDOW, SPECIAL,, 14X36.375X8.625,BLACK MACROFLEX,1/2, GREEN (SOLEX), INSULATED
795166	6499-0386 SV 14.0 X 36.3 X 082 BK VNT INS TP GRN 4.000 RADII
757267	1-6499-00-0-364-176-081-0-3535-0111-0452
770172	3-6499-40-0-364-176-081-0-3535-9331-0452
757273	1-6499-00-0-415-265-170-0-3535-0111-0338
2021105972	EXIT VENT ONLY 6499-30-0338 27.0 X 42.0 X 170 BK G20 TP 4.000 RADII
789575	6499-0508 SV 14.0 X 16.0 X 081 BK TP OBS 3.188 RADII
795133	6499-0508 SV 14.0 X 16.0 X 081 BK VNT TP 1/8 OBS 4.000 RADII
757205	1-6499-00-0-291-175-141-E-3535-5341-0209
789313	6499-0209 SPECIAL SHAPE 17.7 X 29.4 X 141 BK VNT INS TP GRN 4.000 RADII
V000486063	6401 SV 15 X 48 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020217063	VENT / ELEVATED 6401-40-Y SV 15.0 X 170 BK TP G20 4.000 RADII
V000486072	6401 SV 16 X 34 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
770214	VENT ONLY 6401-40 SV 16.0 X 081 BK TP G20 4.000 RADII
V000486078	6401 SV 18 X 18 X 8.1 SCG TP INS BK SKB W/SCRN 3.1875 RADII
2020001431	VENT ONLY 6401-40 SV 18.0 X 081 BK TP 5/32 SCG 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SV Window Variants (Cont'd)

Part Number	Description
V000491136	6401 SV 18 X 30 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000498468	6401 SV 36 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020101668	VENT ONLY 6401-40 SV 36.0 X 081 BK TP G20 4.000 RADII
V000499294	6401 SV 36 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020101668	VENT ONLY 6401-40 SV 36.0 X 081 BK TP G20 4.000 RADII
V000514554	6401 SV 16 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
770214	VENT ONLY 6401-40 SV 16.0 X 081 BK TP G20 4.000 RADII
V000518411	6401 SV 18 X 48 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111565	VENT / ELEVATED, 6401-40-Y SV 18.0 X 081 BK TP G20 4.000 RADII
V000524072	6401 SV 18 X 16 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000531482	6401 SV 18 X 42 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001830	VENT ONLY 6401-40 SV 18.0 X 081 BK TP G20 RADII 4.000
V000553454	6401 SV 16.1 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020111563	VENT / ELEVATED 6401-40-Y SV 16.1 X 081 BK TP G20 4.000 RADII
V000578913	6401 SV 24 X 40 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104607	VENT ONLY 6401-40 SV 24.0 X 081 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 SVD Window Variants

Part Number	Description
V000486183	6402 SVD 48 X 30 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000486181	6402 SVD 48 X 29 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
799857	VENT / LEFT / ELEVATED 6402-40-X SVD 48.0 X 081 BK TP G20 4.000 RADII
804550	VENT / RIGHT / ELEVATED 6402-40-Z SVD 48.0 X 081 BK TP G20 4.000 RADII
V000486185	6402 SVD 48 X 33 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
799857	VENT / LEFT / ELEVATED 6402-40-X SVD 48.0 X 081 BK TP G20 4.000 RADII
804550	VENT / RIGHT / ELEVATED 6402-40-Z SVD 48.0 X 081 BK TP G20 4.000 RADII
V000486199	6402 SVD 53.7 X 22.1 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
774276	VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII
774276	VENT LEFT 6402-40-P SVD 53.7 X 081 BK TP G20 4.000 RADII
V000486189	6402 SVD 48 X 36 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000486233	6402 SVD 60 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2020002737	VENT LEFT 6402-40-P SVD 60.0 X 081 BK TP G20 4.000 RADII
2021012560	VENT RIGHT 6402-40-Z SVD 60.0 X 081 G20 TP BK 4.000 RADII
V000486215	6402 SVD 57 X 20 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
770705	VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII
770706	VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII
V000486216	6402 SVD 57 X 22 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
770705	VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII
770706	VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII
V000486176	6402 SVD 48 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020001433	6402-40-000-475-081-R-3535-9331
2020001436	6402-40-000-475-081-P-3535-9331
V000491995	6402 SVD 60 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020002737	6402-40-000-595-081-P-3535-9331
774073	6402-40-000-595-081-R-3535-9331

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SVD Window Variants (Cont'd)

Part Number	Description
V000486258	6402 SVD 65 X 30.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
809495	VENT RIGHT 6402-40-R SVD 65.0 X 17.0 BK TP G20 4.000 RADII
773803	VENT LEFT 6402-40-P SVD 65.0 X 081 BK TP G20 4.000 RADII
V000486160	6402 SVD 42 X 29 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021000283	VENT/ RIGHT 6402-40-R SVD 42.0 X 081 G20 TP BK 4.000 RADII
805391	VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP G20 4.000 RADII
V000486196	6402 SVD 48.1 X 30.4 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021097029	VENT RIGHT 6402-40-R SVD 48.1 X 170 BK TP G20 4.000 RADII
2021097030	VENT LEFT 6402-40-P SVD 48.1 X 170 BK TP G20 4.000 RADII
V000486238	6402 SVD 60 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
771699	VENT LEFT 6402-40-P SVD 60.0 X 170 BK TP G20 4.000 RADII
772862	VENT RIGHT 6402-40-R SVD 60.0 X 170 BK TP G20 4.000 RADII
V000492692	6402 SVD 65 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
809055	VENT / LEFT / ELEVATED 6402-40-X 65.0 X 081 BK TP G20 4.000 RADII
809061	VENT / RIGHT / ELEVATED 6402-40-Z 65.0 X 081 BK TP G20 4.000 RADII
V000486174	6402 SVD 48 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000486233	6402 SVD 60 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021012559	6402-40-000-595-081-X-3535-9331
2021012560	6402-40-000-595-081-Z-3535-9331
V000486268	6402 SVD 72 X 30 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020106116	VENT LEFT 6402-40-P SVD 72.0 X 081 G20 BK TP G20 4.000 RADII
770199	VENT RIGHT 6402-40-R SVD 72.0 X 081 BK TP G20 4.000 RADII
V000486159	6402 SVD 42 X 24 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021000283	VENT/ RIGHT 6402-40-R SVD 42.0 X 081 G20 TP BK 4.000 RADII
805391	VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP G20 4.000 RADII
V000486184	6402 SVD 48 X 31 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SVD Window Variants (Cont'd)

Part Number	Description
757304	1-6499-00-0-455-715-170-0-3535-0111-0178
2021097100	VENT RIGHT 6499-40-R-0178 72.0 X 46.0 X 17.0 BK TP G20 4.000 RADII
2021097113	VENT LEFT 6499-40-P-0178 72.0 X 46.0 X 17.0 BK TP G20 4.000 RADII
757099	1-6499-00-0-200-415-000-0-3535-0111-0294
2020104691	LEFT VENT ONLY 6499-40-0294 42.0 X 20.3 G20 TP INS BK 4.000 RADII
852246	R-VENT 6499-0294 42.0 X 20.3 BK TP G20 4.000 RADII
757148	6402 SVD 48 X 18 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
757193	1-6499-00-0-260-595-000-0-3535-0111-0324
2021105958	LEFT VENT ONLY 6499-40-P-0324 60.0 X 26.3 G20 BK G20 TP 4.000 RADII
2021105956	RIGHT VENT ONLY 6499-40-R-0324 60.0 X 26.3 G20 BK G20 TP 4.000 RADII
V000486157	6402 SVD 42 X 22 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
805391	VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP G20 4.000 RADII
2021000283	VENT/ RIGHT 6402-40-R SVD 42.0 X 081 G20 TP BK 4.000 RADII
V000486158	6402 SVD 42 X 24 X 8.1 SCG TP INS BK SKB W/SCRN 3.1875 RADII
810970	VENT RIGHT 6402-40-R SVD 42.0 X 081 BK TP SCG 4.000 RADII
810991	VENT LEFT 6402-40-P SVD 42.0 X 081 BK TP SCG 4.000 RADII
V000486177	6402 SVD 48 X 26 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000486189	6402 SVD 48 X 36 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000486217	6402 SVD 57 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
770705	VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII
770706	VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII
V000486221	6402 SVD 57 X 35 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
770705	VENT / LEFT / ELEVATED 6402-40-57.0 X 081-X BK TP G20 4.000 RADII
770706	VENT / RIGHT / ELEVATED 6402-40-Z SVD 57.0 X 081 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SVD Window Variants (Cont'd)

Part Number	Description
V000496892	6402 SVD 60.1 X 29.2 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106308	VENT / LEFT 6402-40-P SVD 60.2 X 081 BK G20 TP 4.000 RADII
2021106307	VENT / RIGHT 6402-40-R SVD 60.2 X 081 BK G20 TP 4.000 RADII
V000530962	6402 SVD 42 X 29 X 8.1 G20 TP INS BK EL OP MKB W/SCRN 3.1875 RADII
769666	VENT / RIGHT / ELEVATED 6402-40-Z SVD 42.0 X 081 BK TP G20 4.000 RADII
786884	VENT/LEFT/ELEVATED 6402-40-X SVD 42.0 X 081 BK TP G20 4.000 RADII
V000518428	6402 SVD 42 X 48 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
769666	VENT / RIGHT / ELEVATED 6402-40-Z SVD 42.0 X 081 BK TP G20 4.000 RADII
786884	VENT/LEFT/ELEVATED 6402-40-X SVD 42.0 X 081 BK TP G20 4.000 RADII
V000531263	6402 SVD 41 X 20.3 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
771851	VENT RIGHT 6402-40-R SVD 41.0 X 081 BK TP G20 4.000 RADII
812560	VENT LEFT 6402-40-P SVD 41.0 X 081 BK TP G20 4.000 RADII
V000538917	6402 SVD 48 X 33 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020104158	VENT RIGHT 6402-40-R SVD 48.0 X 081 BK TP G20 4.000 RADII
2020104159	VENT LEFT 6402-40-P SVD 48.0 X 081 G20 TP BK 4.000 RADII
V000554404	6402 SVD 41.5 X 31 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106360	VENT / LEFT 6402-40-P 41.5 X 081 BK G20 TP 4.000 RADII
806803	VENT RIGHT 6402-40-R SVD 41.5 X 081 BK TP G20 4.000 RADII
V000561679	6402 SVD 60 X 26 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021012559	VENT LEFT 6402-40-X SVD 60.0 X 081 G20 TP BK 4.000 RADII
2021012560	VENT RIGHT 6402-40-Z SVD 60.0 X 081 G20 TP BK 4.000 RADII
V000565434	6402 SVD 54 X 24 X 8.1 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021000483	VENT / LEFT 6402-40-X SVD 54.0 X 081 G20 TP BK 4.000 RADII
2021000484	VENT / RIGHT 6402-40-Z SVD 54.0 X 081 G20 TP BK 4.000 RADII
V000574335	6402 SVD 36 X 48 X 8.1 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020126223	VENT / LEFT 6402-40 SVD 36.0 X 081 BK TP G20 4.000 RADII
778521	VENT RIGHT 6402-40-R SVD 36.0 X 081 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent




6400 SVSE Window Variants

Part Number	Description
V000494826	6405 SVSE 58 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020328858	VENT EXIT RIGHT 6405-30-R SVSE 58.0 X 170 BK TP G20 4.000 RADII
785513	VENT LEFT 6405-40-P SVSE 58.0 X 170 BK TP G20 4.000 RADII
V000493200	6405 SVSE 42 X 24 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
808955	VENT EXIT RIGHT 6405-30-R SVSE 42.0 X 170 BK TP G20 4.000 RADII
2020134629	VENT LEFT 6405-40-P SVSE 42.0 X 170 BK TP G20 4.000 RADII
V000486369	6405 SVSE 58 X 30 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2020328858	VENT EXIT RIGHT 6405-30-R SVSE 58.0 X 170 BK TP G20 4.000 RADII
785513	VENT LEFT 6405-40-P SVSE 58.0 X 170 BK TP G20 4.000 RADII
757152	1-6499-00-0-235-355-170-E-3535-9331-0020
806053	6499-30-R-0020 EXIT/VENT 36.0 X 24.0 X 170 BK 1/8" G20 INS 4.000 RADII
853120	P-VENT 6499-40-0020 36.0 X 24.0 X 170 BK TP G20 4.000 RADII
757189	1-6499-00-0-255-475-170-E-3535-0111-0054
2020335180	VENT/EXIT 6499-30-R-0054 SESV 48.0 X 26.0 X 170 G20 TP BK 4.000 RADII
2021017019	VENT 6499-40-X-0054 SVSE 48.0 X 26.0 X 170 G20 TP BK 4.000 RADII
V000515108	6405 SVSE 42 X 33 X 17 G20 TP INS BK EL OP SKB W/SCRN 3.1875 RADII
2021098110	VENT / LEFT / ELEVATED 6405-40-X SVSE 42.0 X 170 BK TP G20 4.000 RADII
2021098115	VENT / RIGHT / EXIT / ELEVATED 6405-30-Z SVSE 42.0 X 170 BK TP G20 4.000 RADII
V000565706	6405 SVSE 60.1 X 29.2 X 17 G20 TP INS BK SKB W/SCRN 3.1875 RADII
2021106373	VENT / LEFT 6405-40-P SVSE 60.1 X 170 BK G20 TP 4.000 RADII
2021106375	VENT / RIGHT / EXIT 6405-30-R SVSE 60.1 X 170 BK G20 TP 4.000 RADII
760914	6499-0486 SVSE 57 X 326 X 17 G205E TP INS BK SKB W/SCRN 3.1875 RADII
2021106082	LEFT VENT ONLY 6499-40-P-0203 57.0 X 32.6 X 170 BK G20 TP 4.000 RADII
2021105959	RIGHT VENT ONLY 6499-40-R-0486 57.0 X 32.6 X 170 BK G20 TP 4.000 RADII


HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 SVSV Window Variants

Part Number	Description
757311	1-6499-00-0-475-595-170-0-3535-0111-0094
801306	6499-0094 SVT 60.0 X 48.0 X 170 BK R VNT TP INS 1/8 G20 4.000 RADII
2021017812	VENT 6499-40-P-0094 SVSV 60.0 X 48.0 X 170 G20 TP BK 4.000 RADII
757245	1-6499-00-0-335-635-170-0-3535-0111-0176
797137	3-6499-40-0-335-635-170-C-3535-9331-0176
718413	6499-0095 SPECIAL SHAPE 60.0 X 36.0 X 170 BK TP G20 3.188 RADII
813957	R-VENT 6499-0095 60.0 X 36.0 X 170 BK TP G20 4.000 RADII
813958	P-VENT 6499-0095 60.0 X 36.0 X 170 BK TP G20 4.000 RADII



6400 SVT Window Variants

Part Number	Description
792969	6499-0510 SVT 75.0 X 24.0 X 170 BK TP INS G20 3.188 RADII
2020111079	C-VENT 6499-40-C-0510 75.0 X 24.0 BK TP G20 4.000 RADII
2020111693	6499-40-X-0510 LEFT VENT 48.0 X 24.0 X 170 BK TP G20 4.000 RADII
2020111694	6499-40-Z-0510 RIGHT VENT 48.0 X 24.0 X 170 BK TP G20 4.000 RADII
797733	1-6499-00-0-203-657-081-0-3535-5331-0258
2020131078	VENT RIGHT ONLY 6499-40-R-0258 66.2 X 20.6 X 081 BK TP G20 4.000 RADII
2020131079	VENT CENTER ONLY 6499-40-C-0258 66.2 X 20.6 X 081 BK TP G20 0.000 RADII
2020131080	VENT LEFT ONLY 6499-40-P-0258 66.2 X 20.6 X 081 BK TP G20 4.000 RADII

6400 SVEV Window Variants

Part Number	Description
757313	1-6499-00-0-475-695-170-0-3535-0111-0203
2021105973	LEFT VENT ONLY 6499-40-P-0203 70.0 X 48.0 X 170 BK G20 TP 4.000 RADII
2021106081	RIGHT VENT ONLY 6499-40-R-0203 70.0 X 48.0 X 170 BK G20 TP 4.000 RADII
2021106077	CENTER VENT ONLY 6499-40-C-0203 70.0 X 48.0 X 170 BK G20 TP 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent

fixed egress 6400 VEPW Window Variants	
Part Number	Description
V000486848	6473 VEPW 30 X 30 G20 TP INS BK W/SCRN 3.1875 RADII
2021097001	VENT / EXIT 6473-30 VEPW 30.0 X 30.0 BK TP G20 4.000 RADII
V000486850	6473 VEPW 36 X 22 G20 TP INS BK W/SCRN 3.1875 RADII
772346	6473 VEPW 36.0 X 22.0 BK EXIT/VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000486694	6453 VEPW 27 X 26 G20 TP INS BK NO SCR N 3.1875 RADII
2021096842	VENT / EXIT 6453-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII
V000486833	6473 VEPW 27 X 22 G20 TP INS BK W/SCRN 3.1875 RADII
772932	6473 VEPW 27.0 X 22.0 BK EXIT/VNT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000486693	6453 VEPW 27 X 22 G20 TP INS BK NO SCR N 3.1875 RADII
773218	6453 VEPW 27.0 X 22.0 BK EXIT/VENT TP INS 1/8" GL20 SC 1/8" CL 3.188 RADII
V000486696	6453 VEPW 30 X 22 G20 TP INS BK NO SCR N 3.1875 RADII
2020002738	VENT ONLY 6453-40 30.0 X 22.0 G20 TP INS BK 4.000 RADII
V000486831	6473 VEPW 27 X 20.3 G20 TP INS BK W/SCRN 3.1875 RADII
810679	6473 VEPW EXIT VENT 27.0 X 20.3 BK TP G20 4.000 RADII
V000486835	6473 VEPW 27 X 26 G20 TP INS BK W/SCRN 3.1875 RADII
2021097002	VENT / EXIT 6473-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII
V000486854	6473 VEPW 27 X 26 G20/OBS TP INS BK W/SCRN 3.1875 RADII
2021097003	VENT / EXIT 6473-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII
V000491391	6473 VEPW 36 X 26 G20 TP INS BK W/SCRN 3.1875 RADII
2020220010	VENT / EXIT 6473-30 VEPW 24.0 X 36.0 BK TP G20 4.000 RADII
V000486846	6473 VEPW 30 X 24 G20 TP INS BK W/SCRN 3.1875 RADII
2020126217	VENT 6473-40 VEPW 30.0 X 24.0 BK TP G20 4.000 RADII
757249	1-6499-00-0-345-265-000-0-3535-0111-0302
2020219967	6499-30-345-265-3535-9331-0302
V000486853	6473 VEPW 36 X 24 G20 TP INS BK W/SCRN 3.1875 RADII
2020126216	VENT 6473-40 VEPW 36.0 X 24.0 BK TP G20 4.000 RADII
V000486839	6473 VEPW 30 X 20.3 G20 TP INS BK W/SCRN 3.1875 RADII
2021097004	VENT / EXIT 6473-30 VEPW 30.0 X 20.3 BK TP G20 4.000 RADII

HEHR 6400 SERIES WINDOW VENT RECALL

Recall Number:	21E047		
Product:	Hehr 6400 Series Window Vent		
Date:	Original: June 29, 2021	Revision 1: Aug. 12, 2021 Revision 2: Oct. 06, 2021	Labor Rate: Inspection 0.4 hour per unit Replacement 0.5 hour per vent



6400 VEPW Window Variants Continue

Part Number	Description
V000491149	6453 VEPW 42 X 26 G20 TP INS BK NO SCR N 3.1875 RADII
2021106300	VENT / EXIT 6453-40 VEPW 42.0 X 26.0 BK G20 TP 4.000 RADII
V000495234	6453 VEPW 27 X 27 G20 TP INS BK NO SCR N 3.1875 RADII
2021106301	VENT / EXIT 6453-40 VEPW 27.0 X 27.0 BK G20 TP 4.000 RADII
V000497598	6473 VEPW 42 X 26 G20 TP INS BK W/SCR N 3.1875 RADII
2021106310	VENT / EXIT / PUSH BAR 6476-30 VEPW 42.0 X 26.0 BK G20 TP 4.000 RADII
V000570943	6473 VEPW 27 X 30 G20 TP INS BK W/SCR N 3.1875 RADII
2021097002	VENT / EXIT 6473-30 VEPW 27.0 X 26.0 BK TP G20 4.000 RADII
V000522485	6453 VEPW 36 X 24 G20 TP INS BK NO SCR N 3.1875 RADII
2021106424	VENT / EXIT 6453-30 VEPW 36.0 X 24.0 BK G20 TP 4.000 RADII



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.