




3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

NOTE: This document supersedes the previously-released version. All part numbers highlighted in blue have been updated.

Subject

Identification and inspection of a potential adhesive bond issue between the glass and aluminum frame for the following 3000 series frameless windows manufactured between January 6 through January 23, 2020:

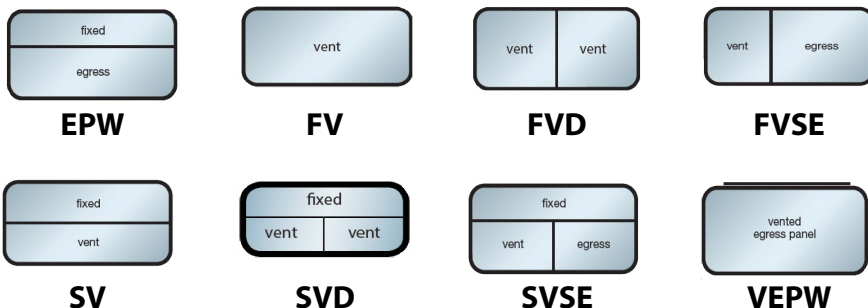

NOTE: See the Variant Codes section starting on page 5 for window and vent sizes and part numbers.

Safety

Read and understand all instructions before installing or operating this product. Adhere to all safety labels.



The "CAUTION" symbol above is a sign that a procedure has a safety risk involved and may cause personal injury, product and/or property damage if not performed safely and within the parameters set forth in this document.



Use appropriate personal protective equipment (PPE) for the procedure being performed.



Moving parts can pinch, crush or cut. Keep clear and use caution.

Resources Required

- Cordless or electric drill or screw gun
- Phillips screw bit
- 3/16" drill bit
- Pop rivet gun
- Ladder



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

Window Identification

Window Size

Window Size ____ X ____ = from inside trim ring RPO label or measure outside the whole/entire window
Width X Height of glass, edge-to-edge.

Egress Windows

- A. Inside the unit an EXIT sticker (Fig. 1) or red handle (Fig. 2A) will be present.
- B. Outside the unit the white backside of the EXIT sticker will be visible.

Insulated Windows

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) or a super spacer (Fig. 4A) sandwiched between two panes of glass can be seen.
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3A) is seen.

Egress and Insulated

- A. Inside the unit a smaller INSULATED WINDOW sticker (Fig. 3) can be seen or the super spacer (Fig. 4A) sandwiched between two panes of glass will be visible in addition to the EXIT sticker (Fig. 1) or red handle (Fig. 2).
- B. Outside the unit the white backside of the INSULATED WINDOW sticker (Fig. 3) can be seen located above the white backside of the EXIT sticker (Fig. 1).

Fig. 1



Fig. 2


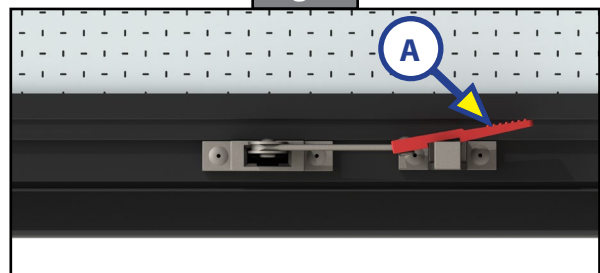


Fig. 3



Fig. 4

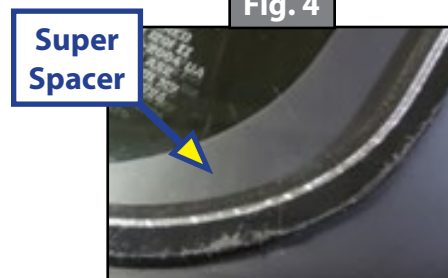

3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020


Inspection

NOTE: Windows must be inspected (viewed) from outside the unit.

1. Make sure the unit is on a level, flat surface then chock the wheels.
2. Inspect the frameless window for proper adhesive bond where the glass meets the hinge frame (Fig. 5A).

NOTE: Fixed glass does not need to be inspected.

Fig. 5

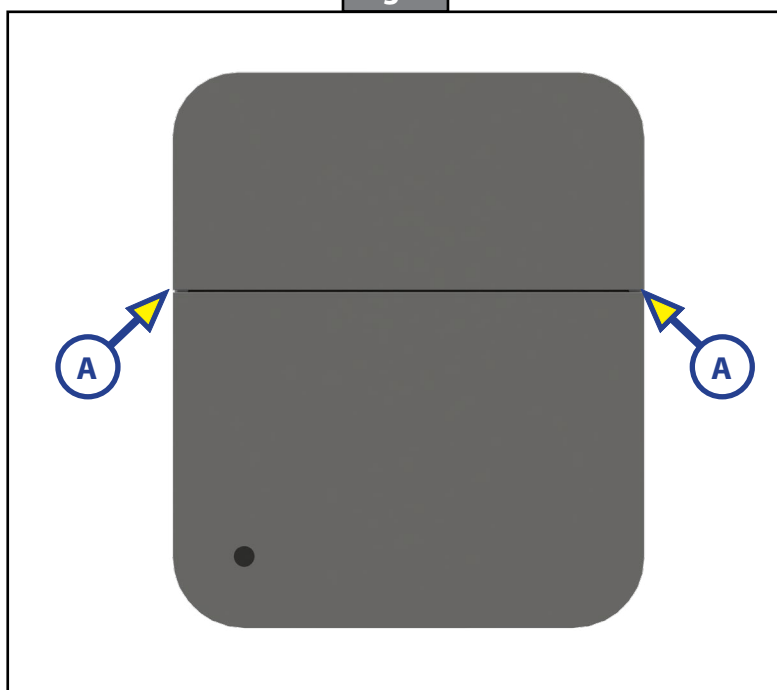

3. Using under 20 pounds of force, or the amount of force it would take to open a car door, test all 3000 series crank-out vent and egress windows by gently tugging on the glass at the frame by hand or with a tool that will not scratch the glass.



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

4. If the glass does not separate from the hinge (Fig. 6A), it is a good bond. **DO NOT REPLACE** the vent. If the glass is not adhering to the vent (Fig. 7A), the glass **DOES NEED TO BE REPLACED**.

Fig. 6

GOOD - GLASS STAYS ON HINGE

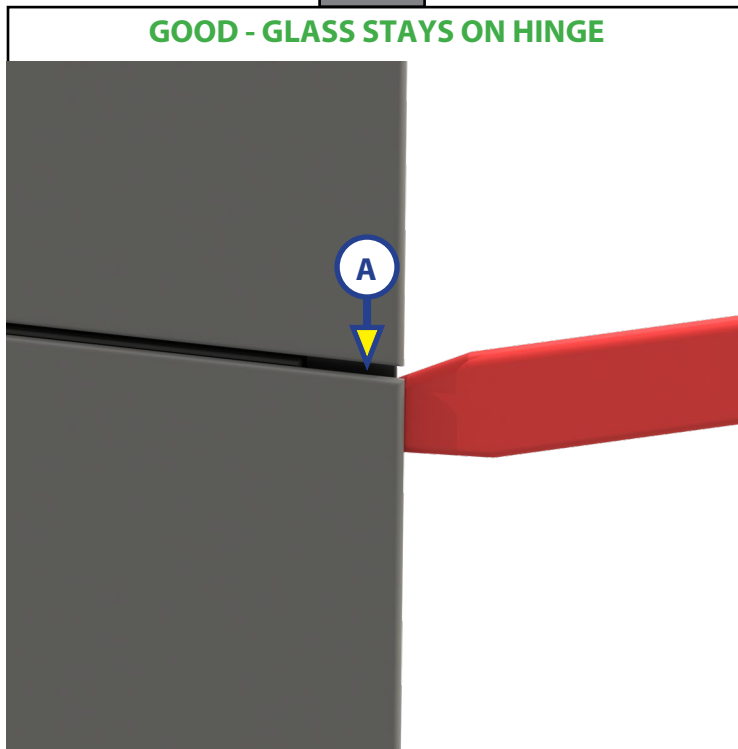


Fig. 7

BAD - GLASS SEPARATES AWAY FROM HINGE



Required Repair Form

<https://support.lci1.com/ti-330-3000-series-window-mullion-vent-replacement>
<https://support.lci1.com/ti-331-3000-series-window-vent-sash-replacement>
[https://support.lci1.com/ti-334-3000-series-window-\(with-scissor-latch\)-vent-replacement](https://support.lci1.com/ti-334-3000-series-window-(with-scissor-latch)-vent-replacement)
<https://support.lci1.com/3000-series-window-assembly>

Action Required

Submit all claims to RV OEM.

Inspection: 0.5 hour per unit

Replacement of glass: 0.3 hour per window

As a supplier of components to the RV industry, safety, education and customer satisfaction are our primary concerns. Should you have any questions, please do not hesitate to contact us at (574) 537-8900 or by email at customerservice@lci1.com. Self-help tips, technical documents, product videos and a training class schedule are available at lci1.com or by downloading the MyLCI app.



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

Variant Codes

In each chart, the vent variant code part numbers and descriptions will be indented under the window variant code part number and description.

fixed egress 3000 EPW Window Variants	
Part Number	Description
V000341326	3000 EPW 27 X 42 X 17 G20 TP BK W/SCRN F300-43137
V000341932	ASSY SASH 3000 EPW 27 G20 TP 3.125 RADII
V000341328	3000 EPW 27 X 42 X 17 G20 TP INS BK W/SCRN F300-43138
V000341933	ASSY IG SASH 3000 EPW 27 G20 TP INS 3.125 RADII
V000341352	3000 EPW 30 X 36 X 17 G20 TP BK W/SCRN F300-43145
V000431278	ASSY SASH 3000 EPW 30 G20 TP 3.125 RADII

vent 3000 FV Window Variants	
Part Number	Description
V000341388	3000 FV 15 X 15 G20 TP BK W/SCRN F300-44201
V000426848	ASSY SASH 3000 FV 15 X 15 G20 TP 3.125 RADII
V000341396	3000 FV 15 X 15 G20 TP INS BK W/SCRN F300-44202
V000426849	ASSY IG SASH 3000 FV 15 X 15 G20 TP INS 3.125 RADII
V000341409	3000 FV 16 X 18 G20 TP INS BK W/SCRN F300-43150
V000579652	ASSY IG SASH 3000 FV 16 X 18 G20 TP INS 3.125 RADII
V000341429	3000 FV 18 X 22 G20 TP INS BK W/SCRN F300-43154
V000341987	ASSY IG SASH 3000 FV 18 X 22 G20 TP INS 3.125 RADII
V000362454	3000 FV 24 X 12 G20 TP BK W/SCRN
V000579687	ASSY SASH 3000 FV 24 X 12 G20 TP 3.125 RADII
V000341470	3000 FV 24 X 15 G20 TP BK W/SCRN F300-43161
V000341988	ASSY SASH 3000 FV 24 X 15 G20 TP 3.125 RADII
V000341472	3000 FV 24 X 15 G20 TP INS BK W/SCRN F300-43162
V000341989	ASSY IG SASH 3000 FV 24 X 15 G20 TP INS 3.125 RADII
V000341483	3000 FV 24 X 20 G20 TP BK W/SCRN F300-43169
V000360100	ASSY SASH 3000 FV 24 X 20 G20 TP 3.125 RADII

LIPPERT
COMPONENTS®

3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO


Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

vent 3000 FV Window Variants (Cont'd)	
Part Number	Description
V000341486	3000 FV 24 X 20 G20 TP INS BK W/SCRN F300-43170
V000426852	ASSY IG SASH 3000 FV 24 X 20 G20 TP INS 3.125 RADII
V000341502	3000 FV 25 X 14 G20 TP BK W/SCRN F300-44684
V000579712	ASSY SASH 3000 FV 25 X 14 G20 TP 3.125 RADII
V000341525	3000 FV 30 X 15 G20 TP BK W/SCRN F300-43178
V000341990	ASSY SASH 3000 FV 30 X 15 G20 TP 3.125 RADII
V000341527	3000 FV 30 X 15 G20 TP INS BK W/SCRN F300-43179
V000341991	ASSY IG SASH 3000 FV 30 X 15 G20 TP INS 3.125 RADII
V000341541	3000 FV 30 X 20 G20 TP BK W/SCRN F300-43183
V000356756	ASSY SASH 3000 FV 30 X 20 G20 TP 3.125 RADII
V000341545	3000 FV 30 X 20 G20 TP INS BK W/SCRN F300-43184
V000579783	ASSY IG SASH 3000 FV 30 X 20 G20 TP INS 3.125 RADII
V000341557	3000 FV 30 X 30 G20 TP BK W/SCRN F300-43187
V000341992	ASSY SASH 3000 FV 30 X 30 G20 TP 3.125 RADII
V000341569	3000 FV 36 X 15 G20 TP BK W/SCRN F300-43188
V000341996	ASSY SASH 3000 FV 36 X 15 G20 TP 3.125 RADII
V000341572	3000 FV 36 X 15 G20 TP INS BK W/SCRN F300-43189
V000341997	ASSY IG SASH 3000 FV 36 X 15 G20 TP INS 3.125 RADII
V000341673	3000 FV 36 X 22 G20 TP BK W/SCRN F300-43192
V000579817	ASSY SASH 3000 FV 36 X 22 G20 TP 3.125 RADII
V000341674	3000 FV 36 X 22 G20 TP INS BK W/SCRN F300-43193
V000579792	ASSY IG SASH 3000 FV 36 X 22 G20 TP INS 3.125 RADII



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020




3000 FVD Window Variants

Part Number	Description
V000341316	3000 FVD 42 X 22 G20 TP BK W/SCRN F300-43360
V000341888	ASSY LEFT SASH 3000 FVD 42 X 22 G20 TP 3.125 RADII
V000341968	ASSY RIGHT SASH 3000 FVD 42 X 22 G20 TP 3.125 RADII
V000341330	3000 FVD 48 X 15 G20 TP BK W/SCRN F300-43199
V000433171	ASSY LEFT SASH 3000 FVD 48 X 15 G20 TP 3.125 RADII
V000429228	ASSY RIGHT SASH 3000 FVD 48 X 15 G20 TP 3.125 RADII
V000341331	3000 FVD 48 X 15 G20 TP INS BK W/SCRN F300-43200
V000580311	ASSY IG LEFT SASH 3000 FVD 48 X 15 G20 TP INS 3.125 RADII
V000580313	ASSY IG RIGHT SASH 3000 FVD 48 X 15 G20 TP INS 3.125 RADII
V000341333	3000 FVD 48 X 18 G20 TP BK W/SCRN F300-43202
V000378153	ASSY LEFT SASH 3000 FVD 48 X 18 G20 TP 3.125 RADII
V000403802	ASSY RIGHT SASH 3000 FVD 48 X 18 G20 TP 3.125 RADII
V000341334	3000 FVD 48 X 18 G20 TP INS BK W/SCRN F300-43366
V000378154	ASSY IG LEFT SASH 3000 FVD 48 X 18 G20 TP INS 3.125 RADII
V000403803	ASSY IG RIGHT SASH 3000 FVD 48 X 18 G20 TP INS 3.125 RADII
V000341338	3000 FVD 48 X 22 G20 TP BK W/SCRN F300-43203
V000342018	ASSY LEFT SASH 3000 FVD 48 X 22 G20 TP 3.125 RADII
V000342022	ASSY RIGHT SASH 3000 FVD 48 X 22 G20 TP 3.125 RADII
V000341339	3000 FVD 48 X 22 G20 TP INS BK W/SCRN F300-43204
V000342019	ASSY IG LEFT SASH 3000 FVD 48 X 22 G20 TP INS 3.125 RADII
V000342023	ASSY IG RIGHT SASH 3000 FVD 48 X 22 G20 TP INS 3.125 RADII
V000341348	3000 FVD 48 X 30 G20 TP BK W/SCRN F300-43212
V000341899	ASSY LEFT SASH 3000 FVD 48 X 30 G20 TP 3.125 RADII
V000341970	ASSY RIGHT SASH 3000 FVD 48 X 30 G20 TP 3.125 RADII
V000341350	3000 FVD 48 X 30 G20 TP INS BK W/SCRN F300-43368
V000341900	ASSY IG LEFT SASH 3000 FVD 48 X 30 G20 TP INS 3.125 RADII
V000341971	ASSY IG RIGHT SASH 3000 FVD 48 X 30 G20 TP INS 3.125 RADII
V000341359	3000 FVD 58 X 15 G20 TP BK W/SCRN F300-43216
V000388746	ASSY LEFT SASH 3000 FVD 58 X 15 G20 TP 3.125 RADII
V000388747	ASSY RIGHT SASH 3000 FVD 58 X 15 G20 TP 3.125 RADII

LIPPERT
COMPONENTS

3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020




3000 FVD Window Variants (Cont'd)

Part Number	Description
V000341361	3000 FVD 58 X 15 G20 TP INS BK W/SCRN F300-43217
V000580357	ASSY IG LEFT SASH 3000 FVD 58 X 15 G20 TP INS 3.125 RADII
V000480412	ASSY IG RIGHT SASH 3000 FVD 58 X 15 G20 TP INS 3.125 RADII
V000341371	3000 FVD 60 X 22 G20 TP BK W/SCRN F300-43218
V000341901	ASSY LEFT SASH 3000 FVD 60 X 22 G20 TP 3.125 RADII
V000341972	ASSY RIGHT SASH 3000 FVD 60 X 22 G20 TP 3.125 RADII
V000341377	3000 FVD 60 X 29 G20 TP BK W/SCRN F300-43221
V000341903	ASSY LEFT SASH 3000 FVD 60 X 29 G20 TP 3.125 RADII
V000341971	ASSY RIGHT SASH 3000 FVD 60 X 29 G20 TP 3.125 RADII
V000341379	3000 FVD 60 X 29 G20 TP INS BK W/SCRN F300-43222
V000341904	ASSY IG LEFT SASH 3000 FVD 60 X 29 G20 TP INS 3.125 RADII
V000341975	ASSY IG RIGHT SASH 3000 FVD 60 X 29 G20 TP INS 3.125 RADII
V000341390	3000 FVD 72 X 28 G20 TP BK W/SCRN F300-43116
V000426862	ASSY LEFT SASH 3000 FVD 72 X 28 G20 TP 3.125 RADII
V000341978	ASSY RIGHT SASH 3000 FVD 72 X 28 G20 TP 3.125 RADII
V000341391	3000 FVD 72 X 28 G20 TP INS BK W/SCRN F300-43982
V000426863	ASSY IG LEFT SASH 3000 FVD 72 X 28 G20 TP INS 3.125 RADII
V000341979	ASSY IG RIGHT SASH 3000 FVD 72 X 28 G20 TP INS 3.125 RADII



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020




3000 FVSE Window Variants

Part Number	Description
V000341402	3000 FVSE 42 X 22 G20 TP BK W/SCRN F300-43381
V000428471	ASSY LEFT SASH 3000 FVD 32.1 X 22 G20 TP 3.125 RADII
V000341934	ASSY RIGHT SASH 3000 FVSE 51.7 X 22 G20 TP 3.125 RADII
V000341405	3000 FVSE 42 X 22 G20 TP INS BK W/SCRN F300-43669
V000580397	ASSY IG LEFT SASH 3000 FVD 32.1 X 22 G20 TP INS 3.125 RADII
V000341969	ASSY IG RIGHT SASH 3000 FVSE 51.7 X 22 G20/CLE TP INS 3.125 RADII
V000341414	3000 FVSE 48 X 22 G20 TP BK W/SCRN F300-43328
V000342000	ASSY LEFT SASH 3000 FVD 44.1 X 22 G20 TP 3.125 RADII
V000341934	ASSY RIGHT SASH 3000 FVSE 51.7 X 22 G20 TP 3.125 RADII
V000341417	3000 FVSE 48 X 22 G20 TP INS BK W/SCRN F300-43329
V000427053	ASSY IG LEFT SASH 3000 FVD 44.1 X 22 G20 TP INS 3.125 RADII
V000427054	ASSY IG RIGHT SASH 3000 FVSE 51.7 X 22 G20 TP INS 3.125 RADII
V000341463	3000 FVSE 60 X 22 G20 TP BK W/SCRN F300-43532
V000341901	ASSY LEFT SASH 3000 FVD 60 X 22 G20 TP 3.125 RADII
V000426877	ASSY RIGHT SASH 3000 FVSE 60 X 22 G20 TP 3.125 RADII
V000341471	3000 FVSE 60 X 29 G20 TP INS BK W/SCRN F300-43232
V000341904	ASSY IG LEFT SASH 3000 FVD 60 X 29 G20 TP INS 3.125 RADII
V000426885	ASSY IG RIGHT SASH 3000 FVSE 60 X 29 G20 TP INS 3.125 RADII
V000341479	3000 FVSE 72 X 28 G20 TP BK W/SCRN F300-44446
V000426862	ASSY LEFT SASH 3000 FVD 72 X 28 G20 TP 3.125 RADII
V000426898	ASSY RIGHT SASH 3000 FVSE 72 X 28 G20 TP 3.125 RADII
V000341481	3000 FVSE 72 X 28 G20 TP INS BK W/SCRN F300-44447
V000426863	ASSY IG LEFT SASH 3000 FVD 72 X 28 G20 TP INS 3.125 RADII
V000426899	ASSY IG RIGHT SASH 3000 FVSE 72 X 28 G20 TP INS 3.125 RADII




3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020




3000 NV EPW Window Variants

Part Number	Description
V000341306	3000 NV EPW 30 X 36 X 17 G20 TP BK NO SCR N F300-43883
V000431278	ASSY SASH 3000 EPW 30 G20 TP 3.125 RADII
V000346279	3000 NV EPW 36 X 48 X 17 G20 TP INS BK NO SCR N
V000473547	ASSY IG SASH 3000 EPW 36 G20 TP INS 3.125 RADII



3000 NV VEPW Window Variants

Part Number	Description
V000537270	3000 NV VEPW 30 X 20 G20 TP BK NO SCR N
V000341964	ASSY SASH 3000 VEPW 30 X 20 G20 TP 3.125 RADII



3000 SV Window Variants

Part Number	Description
V000385863	3000 SV 12 X 40 X 17 G20 TP BK W/SCR N
V000580594	ASSY SASH 3000 SV 12 G20 TP 3.125 RADII
V000531711	3000 SV 12 X 40 X 17 G20 TP INS BK W/SCR N
V000580595	ASSY IG SASH 3000 SV 12 G20 TP INS 3.125 RADII
V000341588	3000 SV 18 X 22 X 9 G20 TP BK W/SCR N F300-00546548
V000426963	ASSY SASH 3000 SV 18 X 9 G20 TP 3.125 RADII
V000341593	3000 SV 18 X 34 X 17 G20 TP BK W/SCR N F300-43235
V000342006	ASSY SASH 3000 SV 18 G20 TP 3.125 RADII
V000341594	3000 SV 18 X 34 X 17 G20 TP INS BK W/SCR N F300-43236
V000342007	ASSY IG SASH 3000 SV 18 G20 TP INS 3.125 RADII
V000341597	3000 SV 18 X 36 X 17 G20 TP BK W/SCR N F300-43387
V000342006	ASSY SASH 3000 SV 18 G20 TP 3.125 RADII
V000341598	3000 SV 18 X 36 X 17 G20 TP INS BK W/SCR N F300-43302
V000342007	ASSY IG SASH 3000 SV 18 G20 TP INS 3.125 RADII
V000341609	3000 SV 18 X 48 X 17 G20 TP BK W/SCR N F300-43394
V000342006	ASSY SASH 3000 SV 18 G20 TP 3.125 RADII



3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

fixed

vent

3000 SV Window Variants (Cont'd)

Part Number	Description
V000341610	3000 SV 18 X 48 X 17 G20 TP INS BK W/SCRN F300-43395
V000342007	ASSY IG SASH 3000 SV 18 G20 TP INS 3.125 RADII
V000341617	3000 SV 24 X 36 X 17 G20 TP BK W/SCRN F300-43322
V000342009	ASSY IG SASH 3000 SV 24 G20 TP INS 3.125 RADII
V000341618	3000 SV 24 X 36 X 17 G20 TP INS BK W/SCRN F300-43323
V000342009	ASSY IG SASH 3000 SV 24 G20 TP INS 3.125 RADII
V000341622	3000 SV 24 X 48 X 17 G20 TP BK W/SCRN F300-43324
V000342008	ASSY SASH 3000 SV 24 G20 TP 3.125 RADII
V000341632	3000 SV 30 X 36 X 17 G20 TP BK W/SCRN F300-43238
V000365846	ASSY SASH 3000 SV 30 G20 TP 3.125 RADII
V000341635	3000 SV 30 X 36 X 17 G20 TP INS BK W/SCRN F300-43239
V000580624	ASSY IG SASH 3000 SV 30 G20 TP INS 3.125 RADII
V000341643	3000 SV 36 X 36 X 17 G20 TP BK W/SCRN F300-43309
V000342010	ASSY SASH 3000 SV 36 G20 TP 3.125 RADII

LIPPERT
COMPONENTS®

3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO


Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020

fixed vent vent 3000 SVD Window Variants	
Part Number	Description
V000341657	3000 SVD 42 X 36 X 17 G20 TP BK W/SCRN F300-43240
V000341909	ASSY LEFT SASH 3000 SVD 42 G20 TP 3.125 RADII
V000341980	ASSY RIGHT SASH 3000 SVD 42 G20 TP 3.125 RADII
V000341658	3000 SVD 42 X 36 X 17 G20 TP INS BK W/SCRN F300-43365
V000341910	ASSY IG LEFT SASH 3000 SVD 42 G20 TP INS 3.125 RADII
V000341981	ASSY IG RIGHT SASH 3000 SVD 42 G20 TP INS 3.125 RADII
V000341667	3000 SVD 48 X 22 X 9 G20 TP BK W/SCRN F300-00546103
V000372520	ASSY LEFT SASH 3000 SVD 48 X 9 G20 TP 3.125 RADII
V000396155	ASSY RIGHT SASH 3000 SVD 48 X 9 G20 TP 3.125 RADII
V000341669	3000 SVD 48 X 29 X 9 G20 TP BK W/SCRN F300-42057
V000372520	ASSY LEFT SASH 3000 SVD 48 X 9 G20 TP 3.125 RADII
V000396155	ASSY RIGHT SASH 3000 SVD 48 X 9 G20 TP 3.125 RADII
V000341748	3000 SVD 48 X 36 X 17 G20 TP BK W/SCRN F300-43242
V000341911	ASSY LEFT SASH 3000 SVD 48 G20 TP 3.125 RADII
V000341982	ASSY RIGHT SASH 3000 SVD 48 G20 TP 3.125 RADII
V000341749	3000 SVD 48 X 36 X 17 G20 TP INS BK W/SCRN F300-43243
V000341912	ASSY IG LEFT SASH 3000 SVD 48 G20 TP INS 3.125 RADII
V000341983	ASSY IG RIGHT SASH 3000 SVD 48 G20 TP INS 3.125 RADII
V000341774	3000 SVD 60 X 32 X 17 G20 TP BK W/SCRN F300-44039
V000342020	ASSY LEFT SASH 3000 SVD 60 G20 TP 3.125 RADII
V000401622	ASSY RIGHT SASH 3000 SVD 60 G20 TP 3.125 RADII
V000341779	3000 SVD 60 X 36 X 17 G20 TP BK W/SCRN F300-43326
V000342020	ASSY LEFT SASH 3000 SVD 60 G20 TP 3.125 RADII
V000401622	ASSY RIGHT SASH 3000 SVD 60 G20 TP 3.125 RADII
V000341796	3000 SVD 70 X 46 X 17 G20 TP BK W/SCRN F300-43889
V000342016	ASSY LEFT SASH 3000 SVD 70 G20 TP 3.125 RADII
V000408351	ASSY RIGHT SASH 3000 SVD 70 G20 TP 3.125 RADII




3000 SERIES WINDOW VENT BONDING INSPECTION - JAYCO

Recall Number:	20E-039
Product:	3000 Series Windows (EPW, FV, FVD, FVSE, SV, SVD, SVSE, VEPW)
Date:	March 06, 2020



3000 SVSE Window Variants

Part Number	Description
V000341826	ASSY LEFT SASH 3000 SVD 44.1 G20 TP 3.125 RADII
V000426837	ASSY LEFT SASH 3000 SVD 48 G20 TP 3.125 RADII
V000341958	ASSY RIGHT SASH 3000 SVSE 51.7 G20 TP 3.125 RADII
V000341827	3000 SVSE 48 X 36 X 17 G20 TP INS BK W/SCRN F300-43272
V000427003	ASSY IG LEFT SASH 3000 SVD 44.1 G20 TP INS 3.125 RADII
V000341959	ASSY IG RIGHT SASH 3000 SVSE 51.7 G20 TP INS 3.125 RADII
V000341845	3000 SVSE 60 X 48 X 17 G20 TP BK W/SCRN F300-43282
V000342020	ASSY LEFT SASH 3000 SVD 60 G20 TP 3.125 RADII
V000342021	ASSY RIGHT SASH 3000 SVSE 60 G20 TP 3.125 RADII
V000341848	3000 SVSE 60 X 48 X 17 G20 TP INS BK W/SCRN F300-43283
V000361813	ASSY IG LEFT SASH 3000 SVD 60 G20 TP INS 3.125 RADII
V000361808	ASSY IG RIGHT SASH 3000 SVSE 60 G20 TP INS 3.125 RADII



3000 VEPW Window Variants

Part Number	Description
V000341870	3000 VEPW 30 X 20 G20 TP BK W/SCRN F300-43424
V000341964	ASSY SASH 3000 VEPW 30 X 20 G20 TP 3.125 RADII
V000341872	3000 VEPW 30 X 20 G20 TP INS BK W/SCRN F300-43425
V000341965	ASSY IG SASH 3000 VEPW 30 X 20 G20 TP INS 3.125 RADII
V000341891	3000 VEPW 36 X 22 G20 TP BK W/SCRN F300-43434
V000341966	ASSY SASH 3000 VEPW 36 X 22 G20 TP 3.125 RADII
V000341892	3000 VEPW 36 X 22 G20 TP INS BK W/SCRN F300-43433
V000341967	ASSY IG SASH 3000 VEPW 36 X 22 G20 TP INS 3.125 RADII
V000341866	3000 VEPW 27 X 22 G20 TP BK W/SCRN
V000579810	ASSY SASH 3000 VEPW 27 X 22 G20 TP 3.125 RADII



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.