

LEVELING AND STABILIZATION

Introduction

This notice is sent to inform you of important product information concerning your motorhome. Lippert Components, Inc. is contacting owners of certain model year 2016-2019 diesel, Class A motorhomes manufactured through March 20, 2019 by REV Recreation Group, with Power Gear Power Up/Power Down leveling jacks.

Potential Product List:

- 2016-2019 American Dream
- 2016-2019 American Eagle
- 2016-2018 American Revolution
- 2016 American Allegiance
- 2016 American Heritage
- 2016 American Tradition
- 2016 Monaco Dynasty
- 2018-2019 Monaco Marquis
- 2018-2019 Monaco Signature
- 2019 Discovery LXE

Purpose


The purpose of this document is to assist the coach owner inspect LCI/Power Gear Power Up/Power Down leveling jacks for common wear versus abnormal leakage.

NOTE: Use caution when performing your inspection. It is not intended for you to get **under** your motorhome. Make sure you secure the keys and the parking brake is engaged before looking at your leveling jacks.

Inspection


External Leakage

Visually inspect jack for external leakage (Fig. 1). For best results, run the auto-level and auto-retract sequence twice before performing visual inspection. If leaking persists, see the Action Needed section for information on ordering replacement jacks.

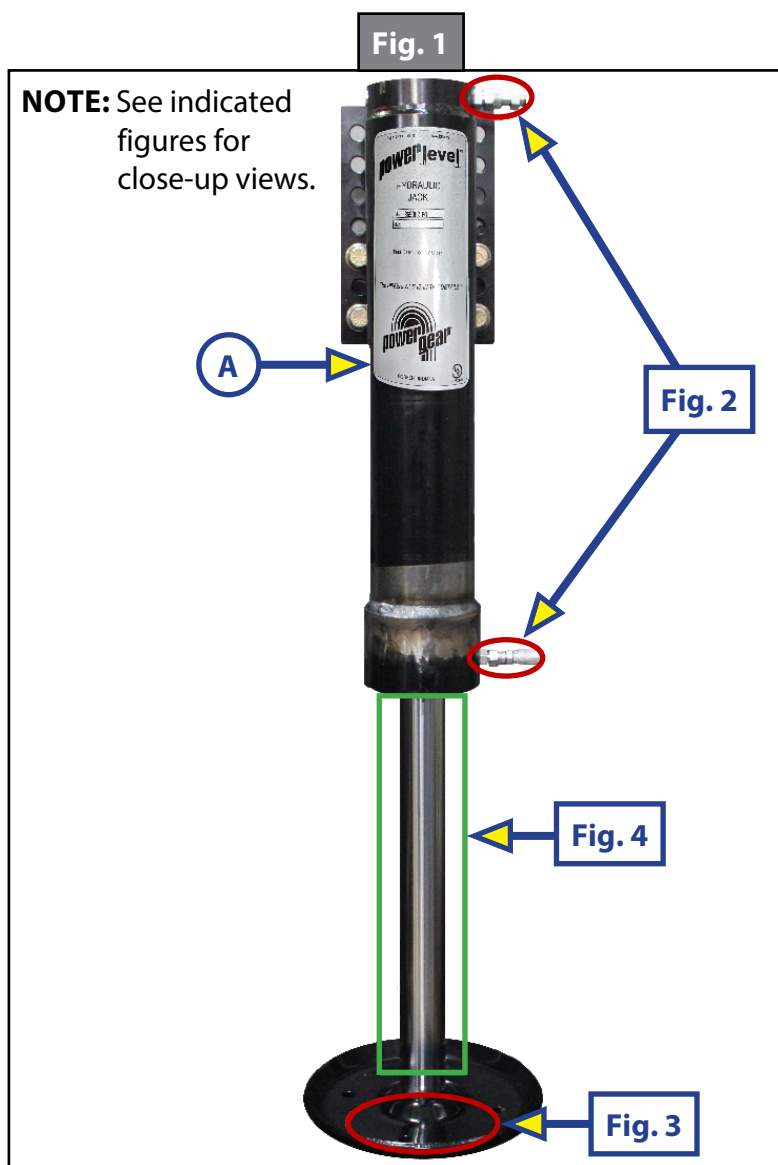


LEVELING AND STABILIZATION

Fig. 2

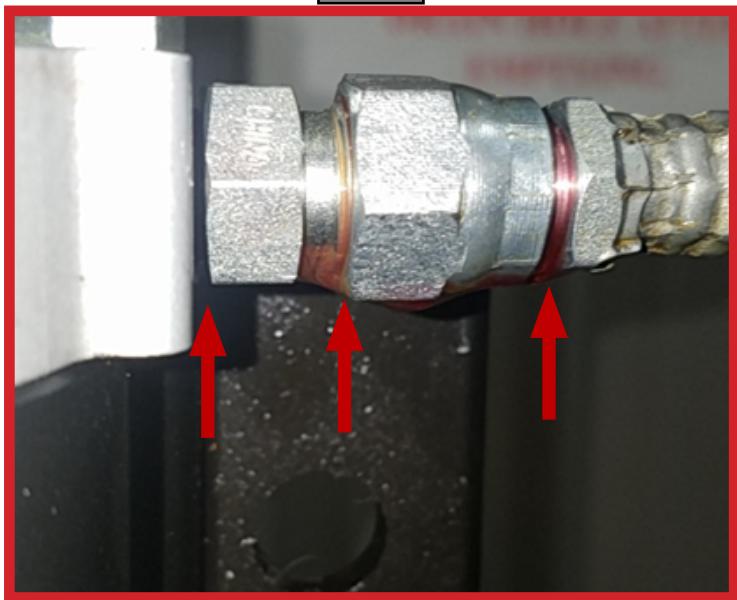

Leaking fitting.

Fig. 3

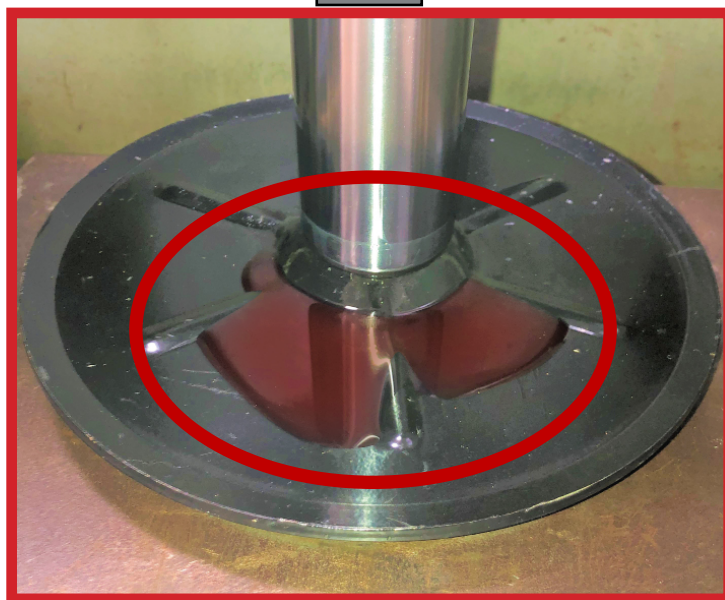

Pooled fluid on footpad.

Fig. 4



A light oil ring on the rod at any jack position is normal and not considered to be a leak. No repair necessary.

You may also contact LCI via phone by calling (574) 537-8900. Please have the coach information requested under Action Needed ready to expedite assistance.

Action Needed

If there is clear evidence of a concern needing jack replacement, please contact your dealer to schedule an appointment.

The inspection and any potential replacements of the subject jack(s) changes is offered free of charge to owners of vehicles listed in this document for a period of one year from the original mailing date of the REV Recreation Group letter related to this QR - 079.

If you are unsure if a concern needs further action, please submit an e-mail to LCI at customerservice@lci1.com and type **REV RV Leveling Jack Inspection** in the subject line.

Please include the following with your e-mail:

- Clear photos of the ID tag on affected jacks (See Fig. 1A).
- Clear photos of leak areas along with any pooling on the jack pads.
- Clear photo of your Vehicle Identification Tag or include the below information when submitting an e-mail to LCI.
 - Full 17-digit VIN
 - Model of Unit
 - Coach Date of Manufacture
 - Retail Date of Purchase
 - Retail Owners Full Name, Address and Phone Number



This manual is provided courtesy of **RV Tech Cheat Sheet**



Professional resources for the whole RV industry — free.

We put manuals, wiring diagrams and hard-won tech knowledge in every technician's hands, so repairs get done right the first time, techs work faster, and RV owners everywhere get better service.



rvtechcheatsheet.com/manuals

Find thousands more RV manuals, wiring diagrams and parts lists

RV techs: share fixes, ask questions and learn from each other.

Join our free Facebook group →



Follow proper safety practices. If in doubt, consult a professional RV technician.